

Lawrence Berkeley National Laboratory

Lawrence Berkeley National Laboratory

Title

Carbon contamination topography analysis of EUV masks

Permalink

<https://escholarship.org/uc/item/6dc1n73z>

Author

Fan, Y.-J.

Publication Date

2010-04-30

Peer reviewed

Carbon Contamination Topography Analysis of EUV Masks

Yu-Jen Fan¹, Leonid Yankulin¹, Petros Thomas¹, Chimaobi Mbanaso¹, Alin Antohe¹, Rashi Garg¹, Yunfei Wang¹, Thomas Murray¹, Andrea Wüest², Frank Goodwin², Sungmin Huh², Aaron Cordes², Patrick Naulleau³, Kenneth Goldberg³, Iacopo Mochi³, Eric Gullikson³, Gregory Denbeaux¹

1. College of Nanoscale Science and Engineering, University at Albany SUNY, Albany, NY
2. SEMATECH, Albany, NY
3. CXRO, Lawrence Berkeley National Laboratory, Berkeley CA

ABSTRACT

The impact of carbon contamination on extreme ultraviolet (EUV) masks is significant due to throughput loss and potential effects on imaging performance. Current carbon contamination research primarily focuses on the lifetime of the multilayer surfaces, determined by reflectivity loss and reduced throughput in EUV exposure tools. However, contamination on patterned EUV masks can cause additional effects on absorbing features and the printed images, as well as impacting the efficiency of cleaning process. In this work, several different techniques were used to determine possible contamination topography. Lithographic simulations were also performed and the results compared with the experimental data.

Keywords: EUV, mask, carbon contamination

1. INTRODUCTION

Carbon contamination on patterned EUV masks is one issue that still must be resolved before EUV lithography is introduced into high volume manufacturing (HVM). It occurs when mask surfaces are exposed to EUV radiation in the presence of residual hydrocarbons. Current solutions are either to reduce the contamination rate and/or to perform a post-cleaning process on contaminated surfaces. Our previous work showed that the topography of the contaminated features is critical to estimate the effects of carbon contamination. Possible contamination topographies from a patterned mask are shown in Figure 1.⁽¹⁾

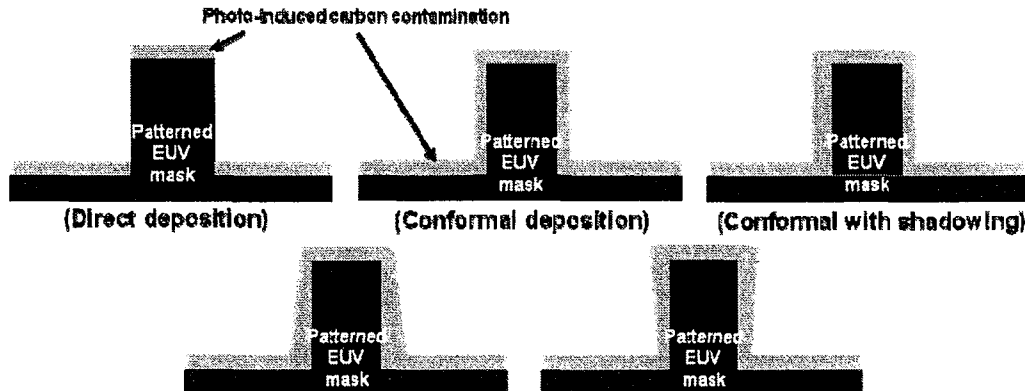


FIG. 1. Different shaped contamination topographies can cause throughput loss, CD change, and dose shift, as well as impacting the efficiency of cleaning process.

The EUV Microscope for Mask Imaging and Contamination Study (MiMICS) tool was built at the College of Nanscale Science and Engineering (CNSE) to study contamination.^[1-3] Selected fields on the mask were contaminated in the EUV MiMICS and analyzed with different tools, including a reticle scanning electron microscope (SEM) for top-down inspection, the SEMATECH Berkeley microfield exposure tool (MET),^[4] the SEMATECH Berkeley actinic inspection tool (AIT),^[5] and an atomic force microscope (AFM).

Lithographic simulations were performed based on the printing results to understand the contamination topography on EUV masks. Using previously determined resist parameters, aerial images were calculated and compared to the experimental data. The simulated results of contamination topography were used to predict carbon thickness that can be allowed when optical correction is applied to the mask.

2. SYSTEM OVERVIEW

A schematic of the EUV MiMICS tool is shown in Figure 2. This tool was designed to study the effects of carbon contamination on the imaging performance of EUV masks. It is equipped with an Energetiq EQ-10M xenon-based discharge-produced plasma EUV source.^[6] The incoming beam reflects off a multilayer mirror at 42° and illuminates the mask at a 6° off-axis angle of incidence. This geometry allows 13.5 nm (92.5 eV) EUV in-band radiation and some longer wavelength up through visible light. Photon energies lower than the bond energies of these carbon-containing molecules are not thought to contribute to the contamination. In order to accelerate carbon deposition rate, local pressure was increased to a level allowing experiments to be performed within a reasonable timeframe. Carbon-containing species were then injected into the vacuum chamber using a needle valve. A 3 × 5 mm oval aperture was used to contaminate only certain features within a selected area.

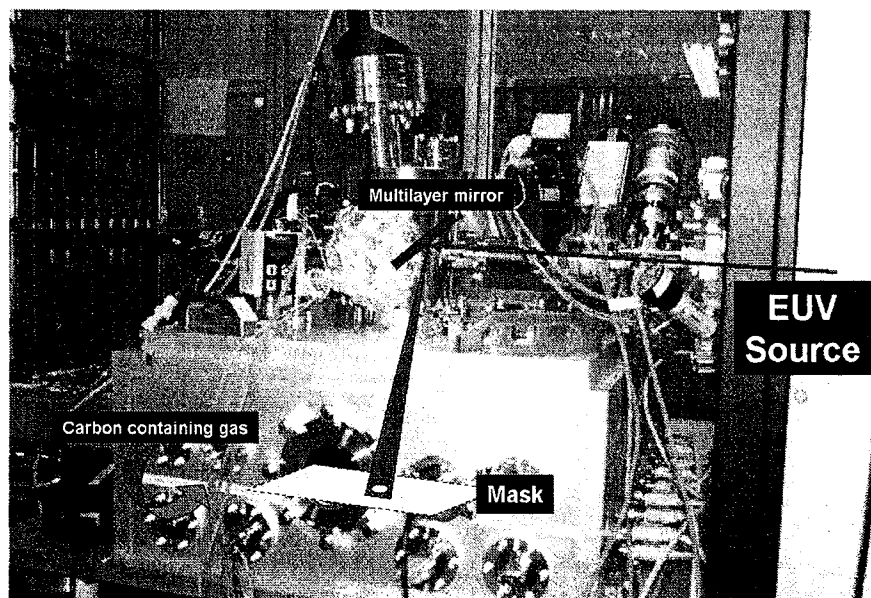


FIG. 2. Layout of the EUV MiMICS at CNSE. Carbon-containing molecules were injected into the vacuum chamber to increase the contamination rate.

The film stack used for this experiment was a Si-capped multilayer mirror with SiO₂ as a buffer layer and TaN as an absorber layer. The stack contains 25 fields with different design features including 80 to 225 nm vertical and horizontal dense lines (16 to 45 nm on the wafer plane when printed in an exposure tool with a demagnification of 5). In addition to the dense 1:1 lines, the duty cycles of the lines and spaces vary from 1:4 to 4:1. Unique labels were also added for easy access to and identification of each field during mask inspection.

3. EXPERIMENTAL RESULTS AND ANALYSIS

Selected fields on the mask were contaminated using the EUV MiMICS tool. The background pressure in the clean chamber was 5×10^{-7} Torr and increased to 3×10^{-6} Torr with carbon-containing gas injected. The accumulated nominal dose for a typical 8-hour exposure is 5 J/cm^2 including EUV in-band and some longer wavelengths. The carbon density was assumed to be 1.5 g/cm^3 throughout this paper based on current literature reviews from 0.8 to 2.2 g/cm^3 .^[7-8]

3.1 Mask Inspection

A top-down reticle scanning electron microscope (SEM) and SuMMIT software were used to record and analyze CD changes on the same field before and after contamination to determine the CD variation of the absorbing features.^[9] The CD change (labeled as ΔCD) and the reflectivity loss were measured on the selected fields and recorded in Figure 3. We observed that carbon contamination results in a reflectivity loss and ΔCD , which implies carbon deposition on the sidewalls of the absorbers.

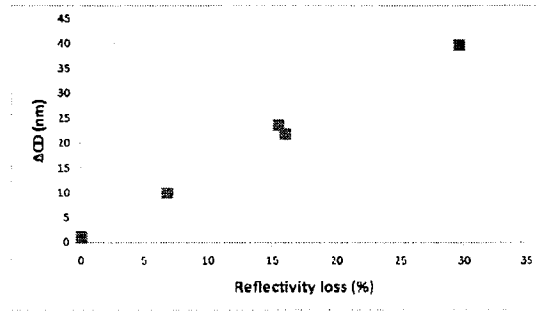


FIG. 3. The CD change was measured as a function of reflectivity loss using a reticle SEM. We observed the ΔCD scales with the reflectivity loss measured from the multilayer surface.

3.2 Features Printing

Images were printed at the SEMATECH Berkeley MET; the exposed wafers were analyzed using a CD-SEM. To investigate the impact of carbon contamination on printing, selected fields on the mask were exposed to EUV radiation with the dose controlled to deposit carbon layers of different thicknesses on each field. Carbon thicknesses were determined to be 8, 19, and 40 nm, respectively, based on the CXRO data and reflectivity measurements before printing.^[10] For a given field on the mask, Figure 4 compares the relative increase in dose to print 40 nm half-pitch dense lines as a function of carbon layer thickness with the relative reflectivity loss for the same carbon thickness. For instance, with 19 nm thick carbon, the dose increased more than 45% while the reflectivity loss was only 16%. This result indicates that the change in dose depends on not only the carbon thickness, and hence reflectivity loss on the mask surface, but also the topography of the contaminated features.

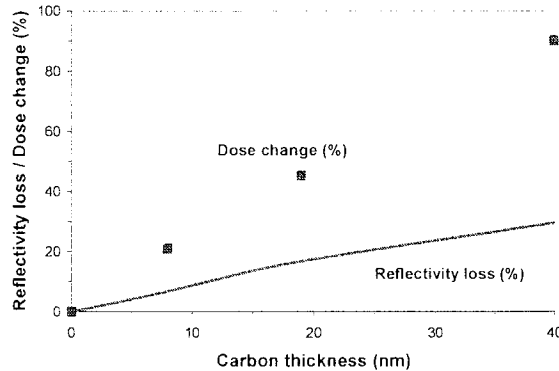


FIG. 4 The required dose change to print dense lines vs. carbon thickness is plotted and compared to the measured reflectivity loss on the selected fields of the mask. Carbon thicknesses were determined by transmission efficiency from the CXRO website.

3.3 Aerial Image Analysis

The SEMATECH Berkeley AIT was used to inspect the contaminated mask and record aerial images. The images underwent aerial image data analysis of through-focus behavior and processing such as CD measurement, contrast curve, normalized image log slope, line width roughness, and process window using ThroughFocus software.^[11] Figure 5 compares 200 nm dense lines on both clean and contaminated regions of the mask, which are recorded as aerial image profiles in Figure 6. The thickness of the carbon deposited on the contaminated mask was 19 nm after EUV exposure in the MiMICS tool with a 5 J/cm² nominal dose.

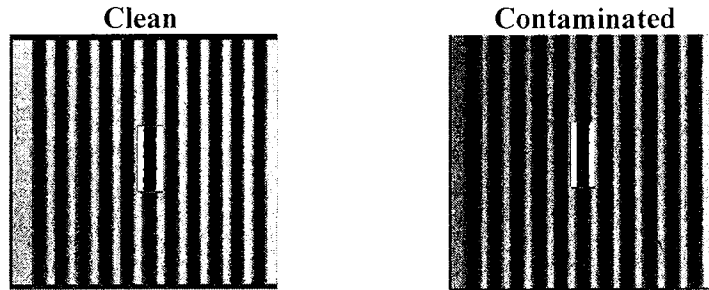


FIG. 5. Aerial images recorded using the SEMATECH Berkeley AIT show 200 nm dense line features on the mask for the clean and contaminated areas. The 0.5 μm x 2 μm boxes shown were selected for data analysis.

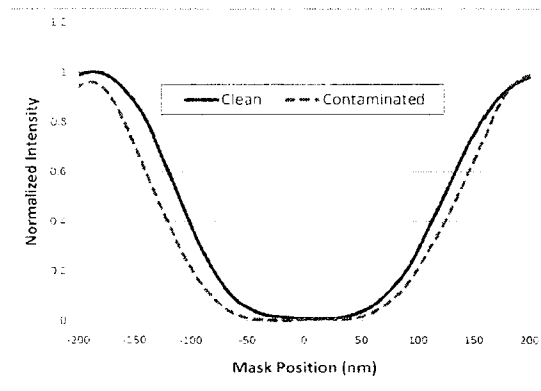


FIG. 6. The intensity profile was recorded based on the location of imaging processing on the mask. Results show an increased CD on a contaminated feature.

3.4 Surface Analysis

A Veeco Dimension 3100 AFM with a high aspect ratio focused ion beam (FIB) tip was used in tapping mode to measure surface topography. The full width at half maximum (FWHM) for the contaminated features increased from 234.8 nm to 275.4 nm, which is a 40.6 nm CD change with 19 nm of carbon deposited on the selected fields of the mask. The root mean square (RMS) roughness of the contaminated region was measured to be 0.45 nm as compared to 0.29 nm in a clean area. The increase of RMS roughness can cause more flare during exposure and could be a potential cause of line edge roughness (LER) on the printed images.^[12-13]

A high precision Veeco InSight 3D-AFM was also used to better understand the contamination topography. With the capability of monitoring changes in the tip width, the tip profile can be recorded before and after the measurement, as shown in Figure 8. The cross section profile can then be mapped out and provide an indication of contaminated absorbing features. More carbon was measured near the top corner of the absorbers after contamination. This non-uniform shape could affect the printing performance more than a simple absorption layer model, as well as causing more throughput loss. However, this cannot yet be considered conclusive until the carbon layer can be measured directly.

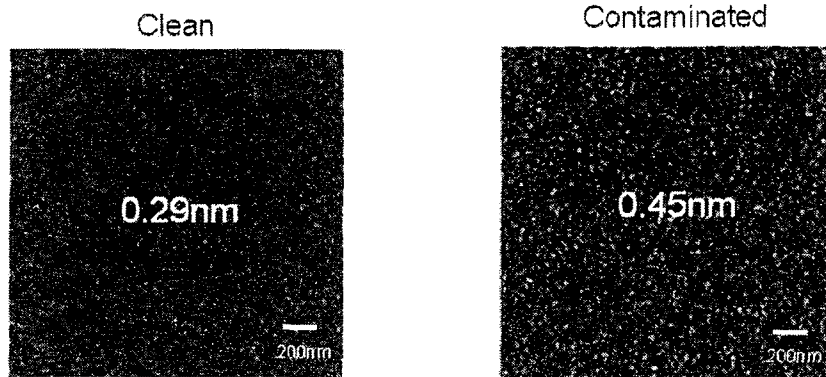


FIG. 7. RMS roughness was increased by approximately 50% on contaminated region with 24 nm of carbon deposited.

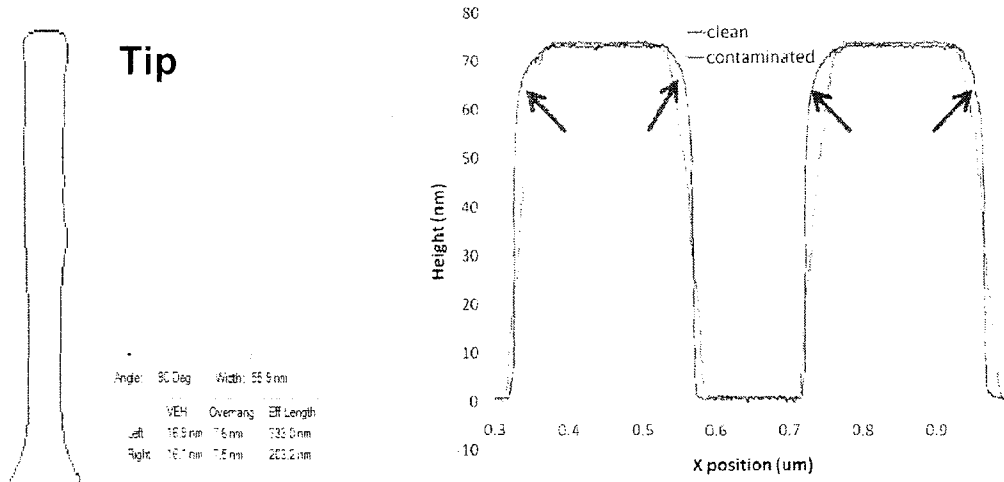


FIG. 8. A tip profile with detailed information indicates the width change before and after the measurement. With capability to monitor tip wear, the cross-sectional profile of contaminated features can be recorded and compared to the clean features on the mask.

4. SIMULATION OF CONTAMINATION TOPOGRAPHY

4.1 Model Development

EM-Suite, lithographic software developed by Panoramic Technology Inc.,^[14-15] was used to investigate the change in the topography of a patterned EUV mask from carbon contamination. It is not yet clear whether the growth rate of the deposited carbon depends on the exposed material such as TaN absorber versus Si or Ru capped multilayers. However, the absorber topography and the illumination angles can still cause different carbon deposition rates between the top surfaces and the sidewalls of the absorbing features. Two extreme cases of possible topography were considered, direct deposition and conformal topography, as shown in Figure 9. Both conformal and direct carbon deposition cause a reflectivity drop due to the absorption of EUV radiation, but the carbon growth on the sidewall in conformal topography increases CD more than direct deposition.

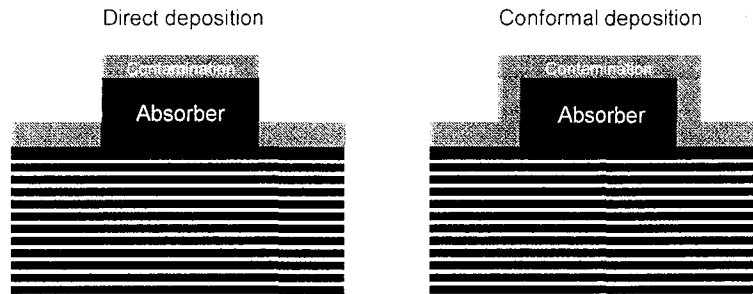


FIG. 9. Two possible topographies: direct and conformal deposition. The film stack used in the simulation consisted of 40 bilayers of Mo/Si, 10 nm of SiO₂ as a buffer layer, and 70 nm of TaN as an absorber layer. The gray layer shown in the schematic view represents the deposited carbon layer.

4.2 Simulation Results

To understand whether our assumptions matched the experimental data, aerial images and calculated resist parameters were compared to the printed results. As shown in Figure 10, the non-uniform shape was based on our best known topography measured by AFM. Two other possible contamination topography shapes, direct and conformal deposition, were also included. Simulation results show that conformal deposition requires more than 45% more dose to print the target CD compared to a clean area printing and that non-uniform deposition is even worse which means the contamination topography affects the throughput significantly.

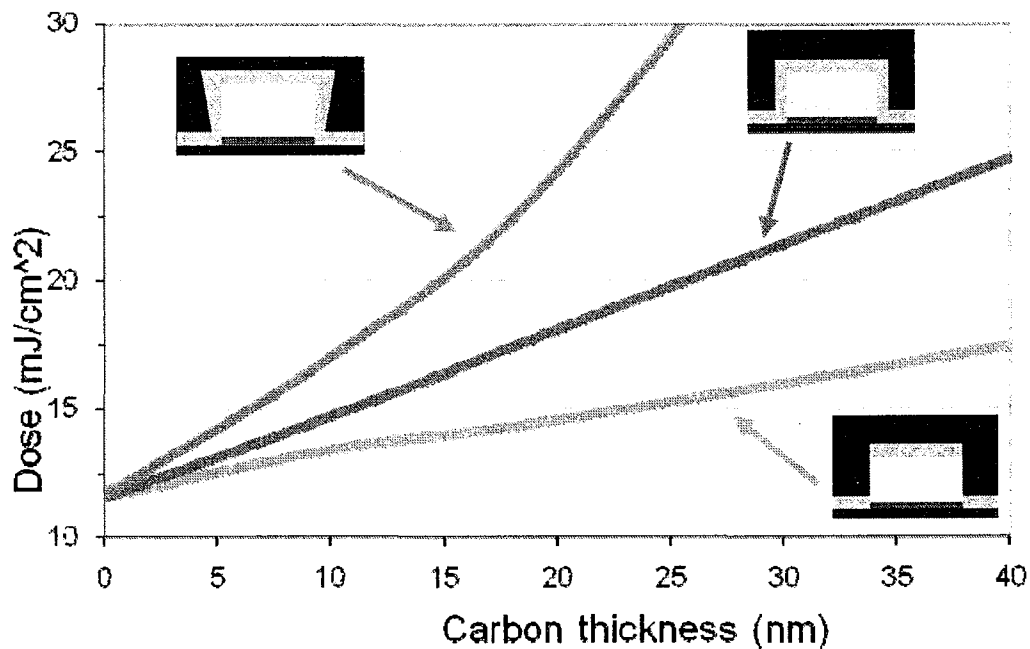


FIG. 10. Simulations were based on our best known topography and compared to direct deposition and conformal deposition.

In actual HVM exposure tools, smaller features, various duty cycles, or unwanted effects such as optical aberrations could make effects of carbon contamination more noticeable even when the carbon layer is thinner. Carbon mitigation has been studied and used to reduce the effect of contamination on multilayer surfaces^[8,16]; however, the removal of contamination on patterned EUV masks needs more study since the absorbing features can be damaged and affect the lifetime of the mask during the carbon mitigation process.

5. CONCLUSION

The lifetime of EUV optics and masks is critical to move EUV lithography from development into HVM. One of the lifetime issues for EUV masks is EUV-induced carbon contamination.

In this work, selected fields on the mask were contaminated and inspected using a top-down SEM and an AFM. Results showed CD changes in contaminated regions on the mask, which indicate the carbon layer also deposited on the sidewall of the absorbers. Due to the oblique illumination in EUV exposure tools, the sidewall contamination causes extra loss of EUV radiation than a simple absorption model. This was also verified by printing experiments. The required dose was increased dramatically by 45% when 19 nm of carbon was deposited. Assuming that the maximum loss in throughput that the industry can tolerate is 5%, which means only 2.5 nm of carbon contamination is allowable. Although the contamination rate in each exposure tool will be different, it is still likely to fall short of the industry goal of a 30,000-hour lifetime for EUV optics and masks.^[17]

Aerial image analysis was used to understand the effects of carbon contamination on imaging. Simulations were also performed with both direct and conformal deposition to compare with the best known data. Preliminary simulation results from previous work showed the maximum allowed contamination was 10 nm before CD compensation failed.^[11] However, the predictions of printing performance can be improved only if the actual topography of the carbon contamination is known.

To date, researchers are investigating various techniques to minimize the effects of carbon contamination on EUV optics, such as different capping layers and atomic hydrogen cleaning.^[17-18] For patterned EUV masks, less work has been completed. Direct measurement of the contamination topography is still a challenge, and more work is needed to provide sufficient data to ready EUV lithography for HVM.

REFERENCES

- [1] Y. Fan et al., "Effect of Carbon Contamination on the Printing Performance of Extreme Ultraviolet (EUV) Masks," *Journal of Vacuum Science and Technology B* 28 (2), (2010). *To be published.*
- [2] Y. Fan et al., "Carbon contamination of extreme ultraviolet (EUV) masks and its effect on imaging," *Proc. SPIE*, Vol. 7271, 72713U (2009).
- [3] G. Denbeaux, "EUV mask and optics contamination," International Workshop on EUV Lithography, Hawaii, USA (2009).
- [4] P. Naulleau et al., "Status of EUV micro-exposure capabilities at the ALS using the 0.3-NA MET optic," *Proc. SPIE* 5374, pp. 881-891 (2004).
- [5] K. A. Goldberg, P. Naulleau, I. Mochi, E. H. Anderson, S. B. Rekawa, C. D. Kemp, and R. F. Gunion, H.-S. Han, S. Huh, "Actinic extreme ultraviolet mask inspection beyond 0.25 numerical aperture," *Journal of Vacuum Science and Technology B* 26 (6), 2220-4 (2008)
- [6] P. Blackborow, M. Partlow, S. Horne, M. Besen, D. Smith, and D. Gustafson, "EUV source development at Energetiq," *Proc. SPIE* Vol. 6921, 692121 (2008).
- [7] J. Hollenshead and L. Klebanoff, "Modeling radiation-induced carbon contamination of extreme ultraviolet optics," *J. Vac. Sci. Technol. B* 24(1), pp. 64-82 (2006).
- [8] Y. Nishiyama, T. Anazawa, H. Oizumi, I. Nishiyama, O. Suga, K. Abe, S. Kagata, and A. Izumi, "Carbon contamination of EUV mask: film characterization, impact on lithographic performance, and cleaning," *Proc. SPIE*, 6921, 692116 (2008)

- [9] <http://www.euvl.com/summit/>
- [10] <http://www.cxro.lbl.gov/>
- [11] <http://ThroughFocus.com>
- [12] H. Tanabe, G. Yoshizawa, Y. Liu, V. Tolani, K. Kojima, and N. Hayashi, "LER transfer from a mask to wafers," *Proc. SPIE*, Vol. 6607, 66071H (2007)
- [13] P. Naulleau and S. George, "How will wafer plane line-edge roughness requirements impact mask specifications?" 2009 International Workshop on EUVL, Hawaii, (2009).
- [14] <http://www.panoramictech.com/>
- [15] T. Pistor, "Expanding the Simulation Capability of TEMPEST," MS thesis, University of California, Berkeley (1997).
- [16] S. Huh et al., "Lifetime of EUVL masks as a function of degree of carbon contamination and capping materials," *Proc. SPIE*, Vol. 6921, 692115 (2008).
- [17] S. Bajt and V. Bakshi, "Optics Contamination," EUV Lithography, SPIE and John Wiley and Sons, Inc., Chapter 6A, pp. 227-259 (2009).
- [18] H Oizumi et al., "Atomic hydrogen cleaning of surface Ru oxide formed by extreme ultraviolet irradiation of Ru-capped multilayer mirrors in H₂O Ambience," *Jpn.J.Appl.Phys.* Vol. 46, No. 25, pp. L633-L635 (2007).

Supported by the U.S. Department of Energy under Contract No. DE-AC02-05CH11231.

Advanced Materials Research Center, AMRC, International SEMATECH Manufacturing Initiative, and ISMI are servicemarks of SEMATECH, Inc. SEMATECH, and the SEMATECH logo are registered servicemarks of SEMATECH, Inc. All other servicemarks and trademarks are the property of their respective owners.