

Lawrence Berkeley National Laboratory

LBL Publications

Title

Resilient design in nuclear energy: Critical lessons from a cross-disciplinary analysis of the Fukushima Dai-ichi nuclear accident

Permalink

<https://escholarship.org/uc/item/7q22j4rq>

Journal

iScience, 27(4)

ISSN

2589-0042

Authors

Ayoub, Ali
Wainwright, Haruko M
Sansavini, Giovanni
[et al.](#)

Publication Date

2024-04-01

DOI

10.1016/j.isci.2024.109485


Copyright Information

This work is made available under the terms of a Creative Commons Attribution License, available at <https://creativecommons.org/licenses/by/4.0/>

Peer reviewed

Article

Resilient design in nuclear energy: Critical lessons from a cross-disciplinary analysis of the Fukushima Dai-ichi nuclear accident

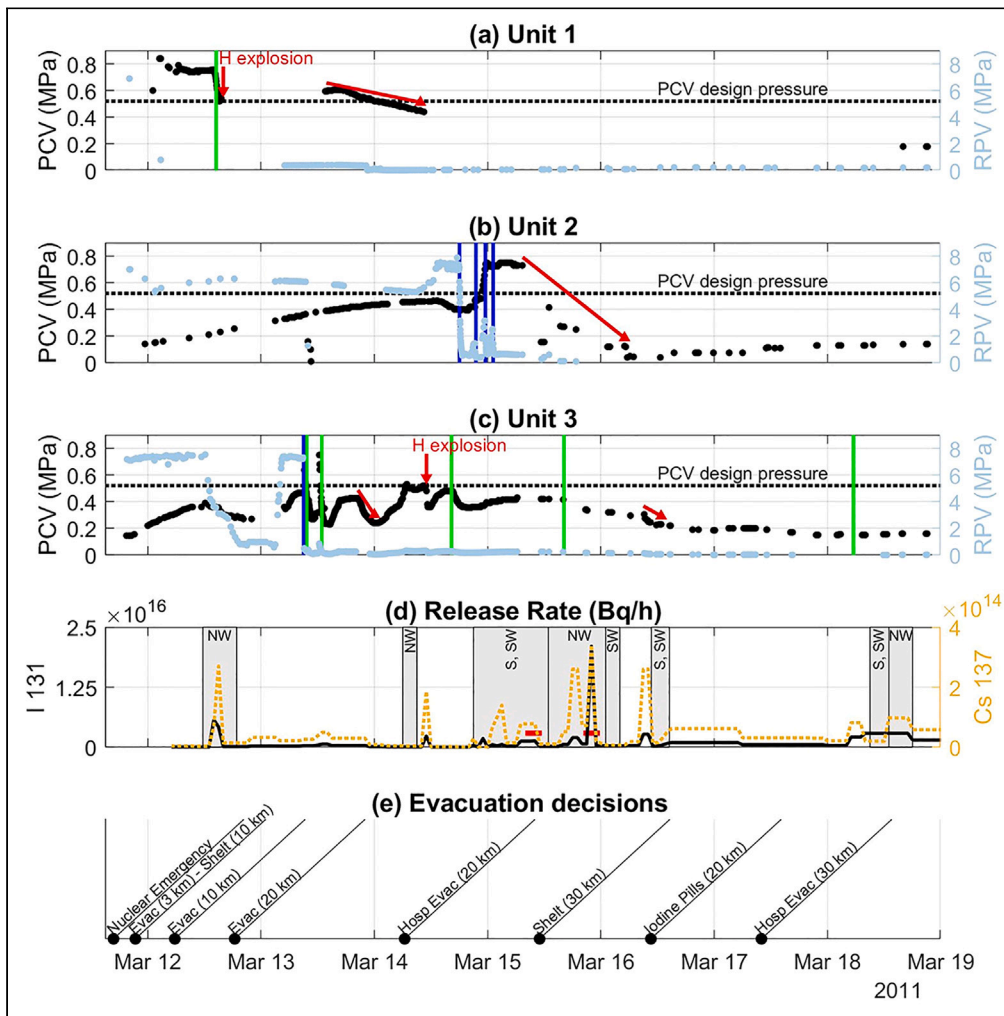

Ali Ayoub, Haruko M. Wainwright, Giovanni Sansavini, Randall Gauntt, Kimiaki Saito

aliayoub@mit.edu

Highlights

Cross-disciplinary analysis identified the key factors that exacerbated the accident

Failing to vent Unit 2 PCV is behind the largest radioactive release and contamination

Nuclear safety should include resilience measures assuming accidents may happen

New technologies are proposed for accident mitigation and adaptive evacuation strategies



Article

Resilient design in nuclear energy: Critical lessons from a cross-disciplinary analysis of the Fukushima Dai-ichi nuclear accident

Ali Ayoub,^{1,5,*} Haruko M. Wainwright,¹ Giovanni Sansavini,² Randall Gauntt,³ and Kimiaki Saito⁴

SUMMARY

This paper presents a multidisciplinary analysis of the Fukushima Dai-ichi Nuclear Power Plant accident. Along with the latest observations and simulation studies, we synthesize the time-series and event progressions during the accident across multiple disciplines, including in-plant physics and engineering systems, operators' actions, emergency responses, meteorology, radionuclide release and transport, land contamination, and health impacts. We identify three key factors that exacerbated the consequences of the accident: (1) the failure of Unit 2 containment venting, (2) the insufficient integration of radiation measurements and meteorology data in the evacuation strategy, and (3) the limited risk assessment and emergency preparedness. We conclude with new research and development directions to improve the resilience of nuclear energy systems and communities, including (1) meteorology-informed proactive venting, (2) machine learning-enabled adaptive evacuation zones, and (3) comprehensive risk-informed emergency planning while leveraging the experience from responses to other disasters.

INTRODUCTION

Resilience is defined as the ability of a community or technological system to prepare for, absorb, and recover from disasters.¹ Building a resilient framework starts from the assumption that accidents—particularly low-probability but high-consequence events—are unavoidable, and then focuses on mitigating their consequences. Nuclear energy communities have made tremendous efforts to prevent accidents through advanced engineering solutions, risk assessments, and safety upgrades.² As a result, the nuclear power industry has one of the lowest accident rates among energy industries.³ However, accidents could happen,^{4–6} In fact, several high-profile nuclear accidents have led to significant impacts on the people and the environment. Currently, safety concerns still hinder the license renewal of existing nuclear power plants (NPPs) and the siting of new plants, even while there is renewed interest in nuclear power as a low-emission source.

In particular, the accident at the Fukushima Dai-ichi Nuclear Power Plant (FDNPP) on March 11, 2011, has had significant health, psychological, and economic impacts not only on the affected communities in the Fukushima prefecture and beyond, but also on the choice of electricity-generation technologies across the world.⁷ Even though no public health consequences have been reported as a result of direct radiation exposure,⁸ the accident has had a negative impact on the general public health, because of prolonged relocations and emotional distress, as well as harm to the local economy. Although the FDNPP accident was triggered by an extreme tsunami, the possibility of similar nuclear power plant accidents should not be dismissed. The chances of other severe floodings are non-negligible, and similar near-miss incidents have been documented at other locations.⁵ Additionally, the extended loss of off-site power has been reported at the Zaporizhzhya Nuclear Power Plant (Ukraine) due to the Russia-Ukraine conflict in September and November 2022. As such, it is crucial to be prepared for potential risks of similar nature.

Over the past ten years, there have been numerous studies across disciplines, analyzing the cause and progression of the accident, and identifying mistakes and lessons. One group of studies addresses the onsite engineering and severe accident management issues, such as multi-unit complications and needed improvements.^{9–11} Others examine the fundamental flaws related to the plant design, such as the seawall height, plant elevation and siting, and the flood-prone emergency diesel generators, while drawing insightful lessons from the successful near-miss mitigation at the nearby Onagawa plant.^{12,13} Some discuss the organizational, safety culture, and regulatory flaws.¹⁴ Meanwhile, several studies focus on the offsite emergency response issues, extracting lessons in emergency preparedness and radiation protection.^{15,16} At the same time, many others address the environmental consequences of the accident,¹⁷ estimating the amount of released radioactivity (source term),^{18,19} investigating the radionuclide atmospheric transport,^{20,21} and determining the long-term contamination

¹Department of Nuclear Science and Engineering, Massachusetts Institute of Technology (MIT), Cambridge, MA, USA

²Department of Mechanical and Process Engineering, ETH Zurich, Zurich, Switzerland

³Severe Accident Analysis Department, Sandia National Laboratories, Albuquerque, NM, USA

⁴Fukushima Environmental Safety Center, Japan Atomic Energy Agency, Fukushima, Japan

⁵Lead contact

*Correspondence: aliayoub@mit.edu

<https://doi.org/10.1016/j.isci.2024.109485>



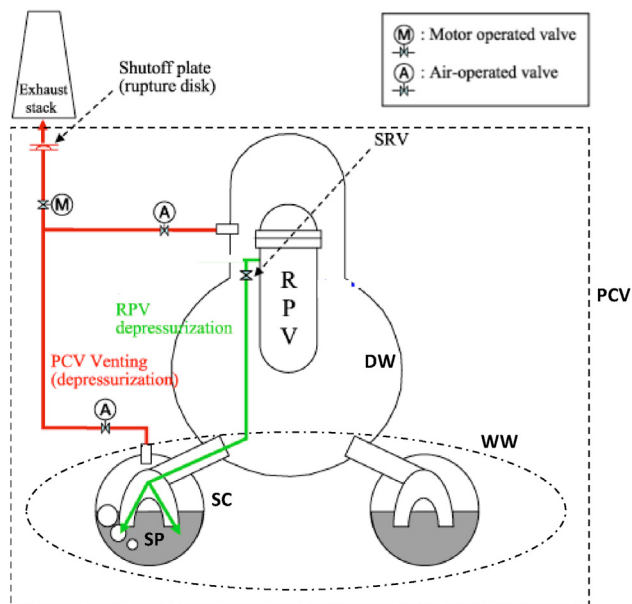


Figure 1. FDNPP generic containment layout, retrieved and modified from TEPCO's schematic (https://www.tepco.co.jp/en/nu/fukushima-np/review/review1_2-e.html; 2022.)

https://www.tepco.co.jp/en/nu/fukushima-np/review/review1_2-e.html The safety relief valves (SRV) can be opened to discharge the RPV excess pressure into the PCV SP (green arrow) and allow the RPV low-pressure injection systems to operate. The PCV consists of an inverted bulb-shaped drywell (DW) made of 30 mm steel, backed by reinforced concrete, and connected to a torus-shaped wetwell (WW) containing the suppression pool beneath. The PCV has two redundant venting lines (red arrows): wet venting from the suppression chamber (SC) (which scrubs the radionuclides before the release to the environment), and dry venting directly from the DW. The PCV vent lines include a rupture disk that bursts when the PCV pressure exceeds the PCV design pressure.

extent.^{22–24} In addition, there have been numerous research estimating the radiation exposure of residents in the Fukushima prefecture,^{25,26} alongside many others exploring the mental,^{27–29} evacuation,^{8,28} and lifestyle-related^{25,30,31} health consequences of the accident.

However, there are only a few studies that cover the FDNPP accident across disciplinary boundaries, including in-plant physics and engineering systems, operators' actions, emergency responses, radionuclide release and transport, and environmental and health consequences. Although there are large government reports available,^{32,33} each discipline has been often discussed separately. In particular, most studies have focused on identifying root causes and accident prevention, with limited research exploring the specific actions or factors that had the most significant impact on the long-term environmental and health consequences. At the same time, while some attempts have been made to extract resilience lessons following the accident, these have either been limited to the theoretical foundations,³⁴ or have been focused on radiological resilience through radiation monitoring and mapping.³⁵ In addition, there have been limited discussion on how we can transfer resilience lessons from other natural and anthropogenic disasters^{36,37} into the nuclear context.

The objective of this study is to provide a comprehensive analysis of the FDNPP accident, across disciplines, and to identify key gaps and potential innovations for improving resilience. In particular, we do not focus on accident prevention but on how to mitigate the consequences of severe accidents. To make an explicit connection between onsite and offsite decision making, we reconstruct the accident timeline across different domains, namely, core and containment status, radioactive releases, and governmental protective measures, and across temporal scales, from the short minutes/hourly events up to the decade-worth long-term and future impacts. In parallel, we summarize the environmental and health consequences in areas within and outside the evacuation zones. We then discuss the key factors in the on-site/off-site emergency responses that led to significant environmental consequences. Finally, we outline the path forward to establish resilience in nuclear energy systems and societies, drawing from our analysis and incorporating the latest advancements from broader research communities.

Plant design and safety features

The FDNPP had six boiling water reactor (BWR) units. The reactor pressure vessel (RPV), which holds the reactor core and coolant, is designed to withstand high temperatures and pressures. The RPV is housed in the primary containment vessel (PCV), which is designed to condense steam, confine fission products in case of an accident, and provide a heat sink and water source for some safety-related systems (Figure 1). In case of an accident or operational disruption, the reactor is shut down by inserting control rods. Different emergency core cooling systems (ECCSs) are in place to remove the decay heat from the core following shutdown and prevent core melting. In the event of loss of off-site power supply, Unit 1 had an isolation condenser (IC) that uses dedicated heat exchangers to maintain core cooling through natural circulation. Units 2–5 had a high-pressure coolant injection system (HPCI) that uses the steam from the reactor to drive its pump and maintain the RPV

water inventory and core cooling during loss of coolant accidents. In addition, Units 2–6 were equipped with a steam-driven reactor core isolation cooling system (RCIC), which provides makeup water from the condensate storage tank (CST) to the RPV. When the CST is depleted, the RCIC suction is switched to the suppression pool (SP), which itself acts as a heat sink for the steam generated in the RPV (steam running the turbine), hence forming a closed-loop cooling cycle.

When the ECCS are unavailable, the core temperature increases to a point at which the oxidation of the zirconium fuel cladding produces hydrogen, which, along with the generated steam during the boil off in the core, can over-pressurize the RPV. If the cladding fails, volatile fission products are released from the core. Although the PCV and the RPV are designed to withstand heavy loads (up to 0.5 MPa³⁸ and 8.7 MPa,³² respectively), venting is a pressure and heat release mechanism necessary to protect their integrity and to allow the low-pressure ECCS to inject water into the reactor.

Accident timeline and consequences

In this section, we reconstruct the FDNPP accident timeline, in Japan Standard Time (JST), starting from the reactor and containment pressure dynamics, and covering radioactive release, offsite contamination, government protective actions, evacuation zones, and health effects. To construct this narrative, we draw the events multiple official investigation reports issued by national and international organizations.^{32,33,38–40} Additionally, we examine the accident progression by cross-referencing the in-plant developments with TEPCO's available RPV and PCV pressure measurement datasets.⁴¹ Furthermore, we assign timings to key physical events—such as core damage, breach of the RPV, core material relocation, and hydrogen explosion—by incorporating recent findings from severe accident simulations.^{42–45} Finally we use the latest source term time-series estimates provided by Terada et al.¹⁸ to establish the connection between the onsite events and their offsite consequences. We have included all the scientific studies, simulations, data sources, and potential uncertainties in the [STAR Methods](#) section.

On the day of the accident, Units 1, 2, and 3 were in normal operation with the RPV pressure at 7 MPa. Units 4, 5, and 6 were shut down for refueling and maintenance outage; hence those units were affected to a lesser extent. Unit 4 had its fuel offloaded to the spent-fuel pool, while Units 5 and 6 had their fuel assemblies in the core.³⁸

March 11

The accident started with an earthquake on March 11 at 14:46 JST, causing the loss of offsite power for all units. The reactors automatically shut down, and cooling systems started operating in all units immediately after. Unit 1 was experiencing excessive cooling rates; thus, the operators decided to stop the IC by closing its control valves at 15:03 to minimize the thermal stress on the RPV. At around 15:40, a 14 m high tsunami arrived and flooded the site, which disabled the onsite emergency power systems and caused a station blackout across all units. Subsequent attempts to open the control valves and restart the IC failed; hence, Unit 1 had no cooling since 15:03.

The operators notified the government at 16:45 that a nuclear emergency was taking place, as specified under the Japanese Nuclear Emergency Act.⁴⁶ Accordingly, the local government ordered the evacuation of residents within a 2 km radius from the plant at 20:50 ([Figure 2E](#)). Just half an hour later, the national government issued an evacuation order for residents within 3 km of the plant and ordered sheltering within 3–10 km from the plant.¹⁵

March 12

Due to the loss of cooling, Unit 1 was the first to experience core damage. Molten core material breached the RPV, which depressurized from 6.9 MPa to less than 1 MPa between the evening of March 11, and 02:45 on March 12 ([Figure 2A](#)).⁴⁵ The pressure in Unit-1 RPV remained low throughout the event, confirming the RPV breach and suggesting that some molten core material relocated to the PCV.⁴⁷ Concurrently, the Unit-1 PCV pressure readings started showing beyond-design values reaching 0.85 MPa at 02:45, as a result of hydrogen accumulation and gas generation from the molten core-concrete interaction.⁴² After several hours of struggles to open the vent lines due to high radiation levels and limited lighting, the operator was able to vent Unit-1 PCV at 14:30³², which led to the recorded PCV pressure drop ([Figure 2A](#)). At 15:36, a hydrogen explosion took place outside the Unit-1 PCV, destroying its reactor building ([Figure 3](#)). Following the venting and the explosion, the onsite monitors detected the first significant release to the environment.³² The estimated release rates were about 5.7×10^{15} Bq/h for ¹³¹I and 2.7×10^{14} Bq/h for ¹³⁷Cs, which happened when the wind was blowing to the northwest ([Figure 2D](#)). The released radioactivity is attributed to the fission products that had leaked through the PCV head and accumulated in the reactor building as a result of excessive strain that stretched the PCV head bolts.⁴⁰

In Unit 2, although the RCIC was running to keep the core cooled from the onset of the event, its water suction source (CST) was being depleted. Accordingly, the suction was switched to the suppression pool cooling mode on March 12 at 05:00³³. This closed-loop RCIC operation, as well as the cycling of the safety relief valves (SRVs) to keep the RPV pressure low, led to an increase in the pressure and temperature of Unit-2 PCV from March 12 onwards ([Figure 2B](#)).

Similarly, the RCIC of Unit 3 was switched to the suppression pool cooling mode after some time, while cycling the SRVs to keep the RPV pressure low, which led to a PCV pressure increase, reaching 0.4 MPa on March 12 at 12:45 ([Figure 2C](#)). The operators then used the fire pumps to cool the PCV, and the pressure dropped to about 0.3 MPa by 20:40. The RCIC stopped operating around noon and could not be recovered afterward; the HPCI system started automatically³³ and brought the RPV pressure down to 1 MPa by 20:40 ([Figure 2C](#)).

Because of the worsening situation, the national government extended the evacuation boundary to 10 km at 05:44 ([Figure 1E](#)) before prompting Unit 1's PCV venting, which was not allowed until the evacuation was completed.³² The wind was blowing to the ocean throughout

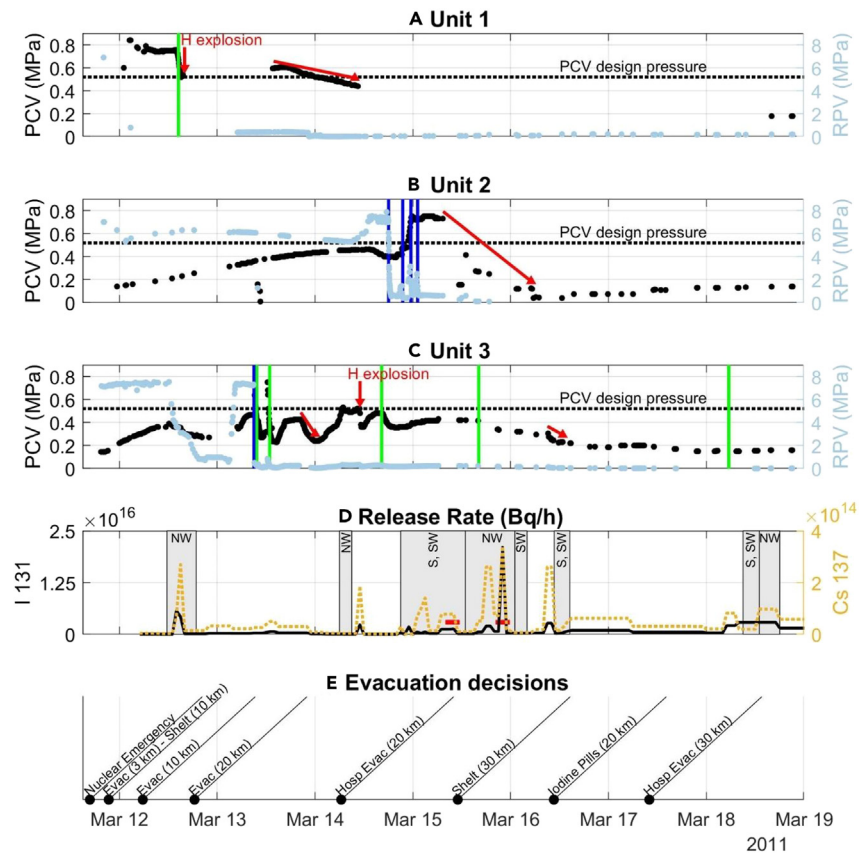


Figure 2. Time sequence of the FDNPP accident

(A–C) the pressure history in the RPV (cyan) and PCV (black) of (A) Unit 1, (B) Unit 2, and (C) Unit 3; (D) release rates of ^{131}I (black) and ^{137}Cs (orange) radioisotopes corrected at shutdown time; and (E) emergency response decisions. In (A)–(C), the vertical blue lines mark the timings of the RPV venting events, the vertical green lines mark the timings of the successful PCV venting events or the ones with associated radioactive release, and the red arrows mark the notable events (hydrogen explosions and structural/functional PCV failures). In (D) the gray boxes represent the time windows when the prevailing wind was blowing inland, and the symbols depicted on top detail the cardinal and ordinal directions to which the wind was blowing (the direction of radionuclide spreading from the FDNPP), wind information is retrieved from the Japanese National Institute of Informatics; the horizontal red dashes cover the time intervals when TEPCO’s nearby car recorded very high dose rates. Contrary to most studies, especially those focusing on the source term estimation and contamination, which visualize the release rates in log scale, we present them on a linear scale to represent the actual contamination and highlight the pulse releases that happened during the accident. Note that following the tsunami and the site flooding, the monitoring of plant parameters was interrupted, then restored in the late evening of March 11.

the whole morning of March 12, but when the venting took place, the wind had shifted toward the inland. Unfortunately, the operators did not consider the wind directions when timing the venting. Following the hydrogen explosion and the associated release, the national government extended the evacuation order to 20 km at 18:25 (Figure 2E).

March 13

At 13:37, the pressure measurements in Unit-1 PCV were re-established. The readings showed a continuous decrease in the PCV pressure until the end of the event (Figure 2A) without any recorded operator actions. Such a continuous decline suggests a PCV “functional failure,” in which the PCV experiences beyond-design leakage rates (see “PCV failure modes” in the STAR Methods).

The RCIC in Unit 2 continued to operate in the recirculation mode throughout March 13; accordingly, the PCV pressure continued to rise (Figure 2B). Although the PCV vent valves were opened, venting could not take place because the pressure stayed below the burst pressure of the rupture disk.

Concerned about the reliability of Unit 3 HPCI turbine (operators were concerned about a potential HPCI turbine failure that could release contaminated steam outside of the PCV when operating on low reactor steam pressure), the operators shut down the HPCI on March 13 at 02:42 and intended to use the low-pressure fire pumps—which were being used for PCV cooling—to cool the RPV. However, the attempts to open the SRVs to maintain a low RPV pressure failed, and the fire pumps did not have enough pressure head to inject water into the high-pressure RPV. With the failure to restart the HPCI, and the ensuing loss of core cooling, the RPV pressure started to increase and reached



Figure 3. The status of the FDNPP Units 1, 2, 3, and 4 after the accident (retrieved and modified from the American Nuclear Society schematic, <https://www.ans.org/news/article-2672/fukushima-daiichi-10-years-on/>)

The hydrogen explosions destroyed the reactor buildings of Units 1, 3, and 4. Unit-4 reactor building experienced a hydrogen explosion due to the backflow of hydrogen from Unit 3 via the interconnected ventilation system.

more than 7 MPa by 04:30 (Figure 2C). Meanwhile, the PCV pressure was building up after switching the fire pumps from PCV cooling and aligning them to cool the RPV. Around 09:00, the SRVs were opened using car batteries.³² Consequently, the RPV pressure decreased to about 0.6 MPa at 09:08, which enabled the fire pumps to inject water into the RPV.¹⁰ However, it is estimated that the core was uncovered and had started to melt by that time.⁴³ With the heat deposited from the RPV, the PCV pressure reached 0.6 MPa by 09:20 (Figure 2C), bursting the rupture disk and releasing the excess pressure through the vent lines that had been previously opened. The PCV vent valves closed several times throughout March 13, due to the “loss of air supply”, and were reopened using mobile compressors (and sometimes manually). This explains the PCV pressure fluctuations in the afternoon of March 13 (Figure 2C), and the radioactive releases associated with the venting events (Figure 2D). The PCV pressure decrease in the late night of March 13 was attributed to a leakage (PCV functional failure) rather than a triggered venting,⁴⁸ and was not associated with a significant release (Figure 2D).

March 14

At around 12:30, the Unit-2 RPV pressure started to increase, implying that the RCIC, and hence the core cooling, had stopped. The operators initiated RPV depressurization to enable the low-pressure fire pumps to cool the core. By 18:47, the RPV was depressurized to 0.6 MPa; as a result, the PCV pressure continued to increase, but remained below the rupture disk’s design pressure (Figure 2B). Although the low-pressure injection to the RPV started around 20:00, the core was uncovered by that time and was damaged during the night of March 14.⁴⁷ The operators continued to open more SRVs to depressurize the RPV over the following hours, and the RPV pressure was responding accordingly, i.e., rising due to the core heat-up, steam generation, and fuel melt, and dropping with the successive RPV venting operations as shown in Figure 2B. The successive SRV openings could be associated with the small releases between 22:00 March 14 and 03:00 March 15 (Figure 2D). Although there was no direct connection between the RPV and the environment, the over-pressurization of the PCV could have resulted in the leakage of hydrogen and fission products from the PCV to the reactor building.⁴⁹ In fact by 23:40, the PCV pressure reached ~0.75 MPa, exceeding the rupture disk’s design pressure; nevertheless, no PCV venting occurred. It was then discovered that a hydrogen explosion in Unit 3 caused the previously opened PCV vent valves of Unit 2 to dislodge and fail closed.³²

Following the core melt in Unit 3, it is estimated that the RPV was breached in the early morning of March 14⁵⁰, thus its pressure remained low afterward, and the PCV pressure started to rise (Figure 2C) due to the large amount of hydrogen. Similar to Unit 2, it is expected that hydrogen and some fission products escaped to the reactor building as a result of the PCV leakage.⁴⁹ The hydrogen mixed with air in the reactor building, forming an explosive gas that ignited and destroyed the reactor building of Unit 3 at 11:00 (Figure 3). The resulting release rates were estimated at 2.3×10^{15} Bq/h ¹³¹I and 1.8×10^{14} Bq/h ¹³⁷Cs (Figure 2D). It should be noted that this estimate assumes that the release rate was similar to that of Unit 1 due to the lack of monitoring data at that time.

By March 14, according to GPS-enabled mobile phone logs,⁵⁰ the evacuation within the 20 km zone was completed. The government ordered the emergency evacuation of the patients who were not yet evacuated from the 20 km evacuation zone. Patient evacuation started in the early morning of March 14 (Figure 2E). Since no previous arrangements were in place, many of the patients were transported more than 200 km, with limited accompanying medical staff, to find admitting facilities.¹⁵

March 15

Operators made several efforts to reopen the PCV vent valves of Unit 2, including attempts at unfiltered venting from the drywell.³² Nevertheless, the loss of DC power and compressed air supply disabled the remote control capability of the vent valves, while radiation levels in the reactor building prevented any manual local actions. With the sustained high PCV pressure and the failure of all venting attempts, Unit-2 PCV

eventually failed, and its pressure dropped sharply between 07:20 and 11:20 on March 15 (Figure 2B), reaching atmospheric pressure by the early morning of March 16. The abrupt pressure drop and the concurrent loud sound heard from the torus room suggest that the Unit-2 PCV experienced a structural failure (see “PCV failure modes” in the STAR Methods). As a result of the March 12 hydrogen explosion in Unit 1, the reactor building of Unit 2 lost its blowout panel,³² creating an opening that enabled the accumulated hydrogen to escape and preventing its explosion,⁴⁴ yet opened a direct path to the environment. It is worth mentioning that there was significant confusion at this time because Unit 4 experienced a hydrogen explosion almost at the same time as the Unit-2 PCV failure and the associated loud sound. It was later confirmed that hydrogen migrated from Unit 3 to Unit 4 through the shared stack.

The highest dose rates recorded onsite during the accident were around this period,⁵¹ specifically ranging between 8 and 12 mSv/h from 08:30–10:30 of March 15, and 4–8 mSv/h in the late night. Similarly, the highest estimated release rates occurred during this same period, reaching 2.1×10^{16} Bq/h ^{131}I and 3.4×10^{14} Bq/h ^{137}Cs (Figure 2D). It is worth highlighting that these few hours of high release are estimated to sum up (by integration, see Figure 2D) to about 31 PBq and 1.5 PBq of ^{131}I and ^{137}Cs , respectively. Therefore, at least 25% and 15% of the total ^{131}I and ^{137}Cs respective estimated releases can be attributed to the unfiltered release from the drywell of the failed Unit-2 PCV. From March 15 onwards, the Unit-2 RPV pressure remained low, suggesting that the RPV breached during that period.

In Unit 3, the operator records⁵² suggest that a wetwell PCV venting took place on March 15 at 16:05, which is confirmed by the simultaneous PCV pressure drop (Figure 2C). However, we expect that the associated radioactive release was small because most of the radioactivity was scrubbed in the wetwell (particulate radioactive material is reduced by a factor of about 1000³³). This can also be confirmed by the records of the onsite radiation monitors that showed no significant increase in dose rates following that venting.⁵¹

With the alarming radiation conditions on site, the national government extended the protective actions and ordered sheltering for residents within 20–30 km from the plant on March 15 at 11:00 (Figure 2E). After this order, the transportation of food and other supplies decreased significantly into the region, due to delivery staff concerns about radiation exposure.⁵³

March 16—onwards

Keeping the vent valves of Unit-3 PCV open was a difficult task throughout the event, owing to the disruptions in compressed air supply. Thus, there were several recorded attempts to reopen the valves and vent the containment.⁵² For example, the release-rate jumps on March 18 starting around 05:30 (Figure 2D) coincide with a venting attempt, although no PCV pressure decrease was recorded (Figure 2C). Conversely, the high release on March 16 between 09:00–11:00 and the continuous release afterward do not match any operator-triggered events; however, they coincide with a pressure decrease (leakage) in Unit-3 PCV (Figure 2C), and potentially further releases from the failed Unit-2 PCV.

The spent-fuel pool in Unit 4, which is outside the PCV, was a major concern at this time, especially after the hydrogen explosion that was initially thought to be caused by the oxidation of fuel cladding in the spent-fuel pool.⁴⁹ Therefore, the US recommended the evacuation of the US citizens living within 50-mile from the plant. This discrepancy in the evacuation zone between the US and Japan added significant confusion among the residents. Later, a helicopter mission confirmed that the spent-fuel pool still contained enough water.⁴⁹

After March 21, no major releases or spikes were recorded onsite,⁵⁴ and by March 22, offsite power was restored. Between March 23 and 25, RPV water injection was switched from sea water to borated fresh water.³⁸ By December 16, a cold shutdown state was reached, and the plant entered the long-term recovery phase.³²

The distribution of potassium iodide (KI) pills did not start until the morning of March 16, after many ongoing discussions within the national government regarding their side effects. However, evacuations were already completed by that time, and some evacuees had already been exposed to radioactive iodine.⁵⁵

The sheltering order remained in place until April 22, when the criteria for deliberate evacuation and relocation were established,³² and the actual public relocation started on May 15. During the extended sheltering period, daily necessities started to run out in the area, and some hospitals had to evacuate their patients (already on March 17) due to the shortage of medical supplies.

Contamination and long-term evacuation zone

The highest radiation air dose rates during the accident were recorded in the nearby southern and southwestern regions of the FDNPP, as well as along the extended northwestern regions (Figure 4A). These high-dose regions were along the directions of the prevailing winds during the major releases, specifically, the March 15 release from Unit 2 (Figure 2D). In addition, precipitation (rain, fog, etc.) caused wet deposition of radionuclides in this region.⁵⁶

For the long-term recovery effort, the radionuclide contamination has been mapped extensively over the years to document the decline in radiation levels and support the return of evacuees (as shown in Figures 4A and 4B which are retrieved from²²). The main contaminant is ^{137}Cs and ^{134}Cs in terms of the exposure dose, after ^{131}I decayed out (8-day half-life). Although the impacted area has been decreasing in size (Figure 4B) following the reduction in radiation levels due to various factors, including decontamination, some parts of the northwestern regions are still designated as difficult-to-return-to zones 11 years after the accident.⁵⁷

Radiation exposure and health consequences

Investigations by international organizations report that there have been no direct deaths among residents due to radiation exposure from the FDNPP accident.⁸ In fact, internal radiation exposure among residents in radiation-contaminated areas was below the

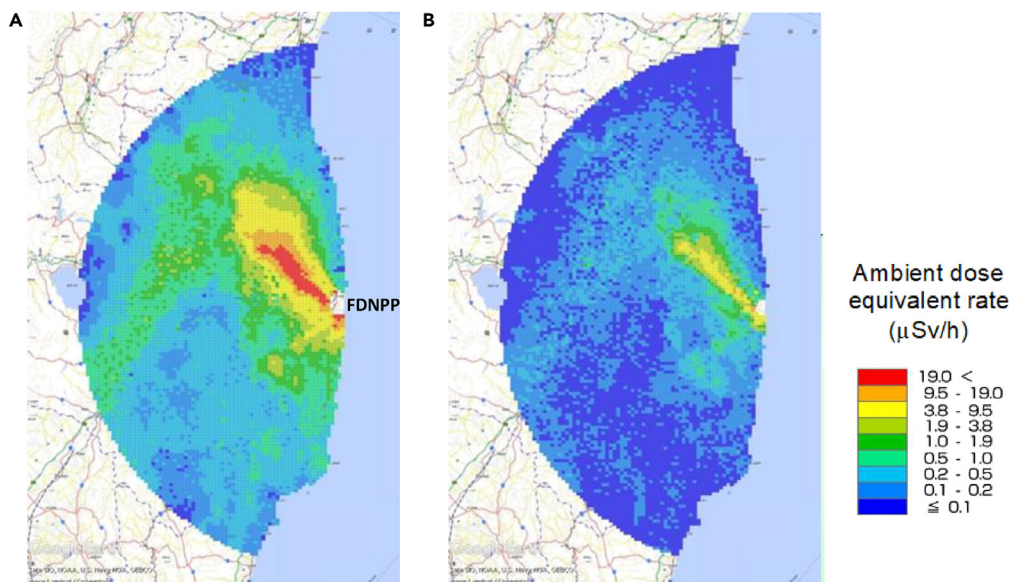


Figure 4. Integrated air dose rate maps in the 80 km zone in (A) 2011 and (B) 2016

The high dose rates are in the northwestern regions of the FDNPP, which is persistent over the time.

minimum level for detection.²⁶ Moreover, according to the Fukushima Health Management Survey, out of about 467,000 residents whose external radiation exposure dose was estimated, 99.8% received less than 5 mSv, and the maximum estimated dose was 25 mSv.²⁵ In contrast, due to delayed evacuations beyond the 20 km evacuation zone, certain areas in the northwestern (e.g., a region in Iitate village) were later assessed to have accumulated a radiation exposure of 50 mSv by the time the official evacuations started.^{15,58}

Several thousands who fled from the disaster zone have reported mental health issues due to family separations, isolations, social distress, and the fear of radioactivity.²⁷ After the accident, 70% of the evacuees reported sleeping difficulties and 15% reported mental health problems.^{27,29} Additionally, evacuees witnessed an increase in lifestyle-related diseases (body weight and obesity) due to limited physical activity and significant changes in dietary habits.²⁵ Studies have reported a statistically significant increase in diabetes,⁵⁹ dyslipidaemia,²⁸ polycythaemia,³⁰ and hyperlipidemia³¹ among evacuees. At least 10 patients with severe medical problems seemed to have died during transportation, and more than 50 others died during, or after, evacuation due to deterioration of their medical conditions as a result of the disorganized evacuation.^{8,28} Studies that followed-up on evacuated patients found that they experienced mortality rates significantly higher than the average.^{8,60}

RESULTS

Key factors that exacerbated accident consequences

The analysis of the FDNPP accident timeline allows to identify three key factors that have significantly impacted the accident consequences. Here, we discuss these factors in conjunction with international standards, practices, and developments.

Containment venting

Our analysis suggests that containment venting was the most important factor in the onsite accident management of the FDNPP accident. Notably, the failure of Unit-2 PCV (March 15) caused the largest radioactive release and land contamination during the entire accident (Figure 2D). This failure can be attributed to the interplay of two main factors. Firstly, a prevailing nuclear industry philosophy that involves delaying PCV venting to postpone environmental releases. Such a philosophy is inherent in the PCV vent line design of the FDNPP, and is shared by other BWRs around the world,⁶¹ featuring a rupture disk that prohibits venting until the PCV pressure exceeds a preset threshold. Secondly, the unexpected hydrogen explosions that complicated the situation onsite and disabled the prepared vent lines. Recent contamination evaluations reveal that the few hours of unfiltered release from the drywell, triggered by Unit-2 PCV failure, contributed to most of the land contamination and the subsequent 10+ years of decontamination efforts and costs.⁶²

Although there are previous studies that have suggested that Unit 2 had the major share of the radioactive release,^{63,64} this study synthesized the in-plant dynamics, wind direction and source term estimation as well as recent simulation studies to confirm the significant contribution of Unit 2, and its PCV venting failure, to the environmental consequences. In fact, a significant portion of the radionuclides from Unit 1 and 3 were considered to be scrubbed in the wet wells,^{42,43} thereby minimizing the release to the environment (Figure 2D). This is despite the fact that Unit 1 was the first to experience core damage and an RPV breach, and that water failed to

reach its core, thus leaving it without cooling for at least 11 days—a conclusion drawn from the limited available data and simulation studies.⁴² Moreover, the contamination associated with the Unit 1 releases is within the 15 km radius, and shows significantly lower air dose rates than the Unit 2 plume.⁶⁵ The wetwell venting of Unit-1 and Unit-3 PCVs protected their integrity in such a way that the PCVs functioned as designed.

To the authors' knowledge, existing severe accident management guidelines (SAMGs) around the world do not consider the prevailing wind directions before initiating PCV venting. In fact, Unit 1 was vented on March 12 at 14:30 when the wind was inland, although it was blowing toward the ocean throughout the period before (Figure 2D), when the Unit-1 PCV pressure was already at its highest (Figure 2A). Nevertheless, despite the favorable wind directions, the operators postponed the decision to vent until the evacuation was completed,³² and the actual venting was further delayed due to technical difficulties.

Moreover, the FDNPP, like many NPPs around the world, had no filtered containment venting system (FCVS) in place. According to Bal et al.,⁶⁶ current FCVS technologies allow the retention of up to 99.9% of radioactive aerosols. Following the FDNPP accident, Japan decided to install FCVS similar to what most European NPPs have done after Chernobyl.⁶⁷ In turn, the US Nuclear Regulatory Commission ordered BWR owners to install reliable hardened containment vents that can operate during severe accidents, nonetheless, the Commission still maintains that FCVS are not necessary and contends that venting from the wetwell offers sufficient filtration.⁶⁷

Evacuation zone

Owing to the defense-in-depth and the layered confinement structures in an NPP, it usually takes about 12–24 h before a major radioactive release (Figure 2D). During the FDNPP accident, a series of evacuation orders enabled most of the people in the 20 km radius to evacuate before March 15, when the major releases happened (Figure 2E). However, many unexpected events happened during the accident, such as the hydrogen explosions, which complicated the situation onsite and disabled the prepared vent lines. Moreover, the accident development was uncertain and could have been worse, for example, with the potential loss of water in the Unit-4 spent-fuel pool. Given that there was substantial uncertainty regarding the plant conditions, the successively expanding distance-based evacuation zone could have been the most reasonable approach.

However, after the onsite situation stabilized, the distance-based evacuation zone was not timely updated using radiation measurements. In particular, Japan had no predetermined deposition-dose criteria to advise the longer term emergency actions beyond the Emergency Planning Zone (EPZ), although international guidelines such as the 2007 ICRP⁶⁸ were available. As a result, individuals in the northwest, who were outside the evacuation zone, remained in areas with an accumulated radiation exposure of 50 mSv by the time the official evacuation began.⁵⁸ The government adopted the ICRP criteria in April, and defined the Deliberate Evacuation Zone as areas with projected dose exceeding 20 mSv/yr. The actual relocation of some of the highly contaminated areas did not begin until May 15, whereas numerous regions in the western area, though experiencing low dose rates,⁶⁹ were included in the evacuation zone, which exacerbated the relocation-related health consequences. Despite some areas having their evacuation orders gradually lifted after thorough radioactive contamination assessments (e.g., Kawauchi), many residents remain hesitant to return.⁷⁰

For the early phase of a nuclear emergency, international regulatory guidance requires that every NPP establishes an EPZ, i.e., an area with prepared arrangements to assure that prompt protective actions can be taken during a radiological accident.⁷¹ Outside the EPZ, protective actions have to be developed at the time on a need basis, based on dose forecasts.⁷² However, Japan's radioactive release and dose prediction software, SPEEDI, failed to provide quantitative dose forecasts due to the unavailability of plant parameters and source term information in the early phase of the accident.⁷³ Therefore, early-stage protective actions beyond the EPZ were delayed and based on ad-hoc estimates. Following the accident, Japan revised their EPZ scope and expanded it to 30 km.⁷⁴

The current emergency response plans consider different evacuation strategies—for example, proposing a combination of evacuation and sheltering areas, depending on the expected path of the plume, rather than an isotropic/radial evacuation.⁷⁵ Nevertheless, any tailored evacuation scheme requires the availability of sufficient radiation data, as well as reliable real-time plume forecasts. Although there have been many developments in real-time radioactive atmospheric transport and dispersion (ATD) codes,⁷⁶ they still suffer from several limitations. To the authors' knowledge, even state-of-the-art codes (e.g., US LODI⁷⁷) require source term information,^{77,78} which can be difficult to quantify in real time during an accident. Moreover, many codes do not include sufficient uncertainty quantification capabilities, do not assimilate real-time radiation measurements into their predictions,⁷⁹ and/or have very high computational costs that compromise their suitability for real-time emergency applications. These limitations were the reason behind the Japanese government's decision to avoid relying on ATD predictions in future emergencies.⁸⁰

Emergency response planning and preparations

Before the FDNPP accident, the scope of probabilistic risk assessments (PRAs) in Japan was limited to internal events only, and did not consider beyond-core-damage sequences (radioactive release or dose exposure).⁶¹ The probability of a severe accident was considered too low to occur, and severe accidents requiring evacuations were considered impossible.⁸¹ Such perception had a significant influence on how severe accidents and emergency response plans were developed. Moreover, the national emergency management plan was formulated on the presumption that a natural disaster and a nuclear emergency would not take place concurrently. During the FDNPP accident, the interplay between the accident and the natural disasters aggravated the situation, which compromised many of the emergency plan's logistics (e.g., communication, power lines, and infrastructure).

Despite the fact that the evacuation of many patients was delayed, there were no radiation-related deaths in the evacuated patients.⁸ In contrast, the disorganized and rushed evacuation of hospitals caused tens of fatalities, mainly because of the absence of hospital evacuation plans and medical arrangements prior to the accident. According to the National Diet of Japan,⁸² only the Imamura hospital (out of seven hospitals in the region) had an evacuation plan for a nuclear emergency.

In addition, the KI pill distribution was significantly delayed and ineffective, since the pills needed to be taken before, or at the time of, the exposure to radioactive iodine. The delay in implementing the KI measures resulted from the failure of the responsible authority to reach a consensus on the benefits (versus the side effects) of the pills.⁵⁵ To ensure timely intake, several countries pre-distribute the KI pills to the residents within the EPZ as part of their emergency planning.⁸³ Following the FDNPP accident, Japan instructed the pre-distribution of KI pills to the population in the vicinity of nuclear facilities.⁸³

At the same time, sheltering-in-place was not effectively executed during the FDNPP accident due to supply shortages. In particular, hospitals and healthcare facilities were not able to maintain their staffing and daily necessities, which led to increased mortality rates among the sheltering-in-place patients.⁸⁴ Although the IAEA recommends limiting sheltering in place to two days,⁸⁵ the sheltering order was issued on March 15 and remained in place until April 22. Several municipalities had to voluntarily evacuate the sheltering residents, since they ran out of food and other critical supplies. This is primarily because the government did not have any pre-planned measures to cope with extended sheltering periods.

DISCUSSION

Outlook and resilience design

The three key factors identified previously enable us to propose the priority areas for further research and technical innovations for improving the resilience of both the nuclear energy systems and communities. Alongside the existing efforts to prevent accidents, we here identify the areas that are critical to mitigate the accident consequences—with a focus on the enabling technologies. To the authors' knowledge, these aspects have not been reported before.

Meteorology-informed proactive containment venting

Our analysis has highlighted the need to change the prevailing philosophy regarding containment venting. Specifically, containment venting should be viewed as the primary means to protect the containment's integrity and prevent a significant release from "undesigned" pathways, regardless of the reactor technology or containment design. In fact, following the FDNPP accident, the Pressurized and Boiling Water Reactor Owners' Group (PWROG and BWROG) revised the current SAMGs, and proposed "early venting" as a means to preserve the containment's integrity.⁸⁶ Similarly, despite varying designs of advanced reactor containments—some featuring larger volumes or incorporating new safety features like passive containment cooling⁸⁷—venting remains an essential measure to protect the containment during severe accidents.

In particular, the installation of FCVS can facilitate early containment venting decisions and further reduce the environmental contamination. To enhance venting reliability, venting systems should include redundant lines that make use of passive concepts (e.g., hydrostatic pressure-based), fail-safe designs (e.g., fail-open isolation valves), and/or valves that can be operated manually outside or from a shielded area. Furthermore, in line with the US FLEX strategies,⁸⁸ ensuring additional support systems (pressurized tanks, compressors, or batteries etc.) in a nearby bunkered building will enable the operation of necessary components in case of the loss of direct driving power.

Additionally, wind forecasting—which we identify as a major driver for determining the accident impact—has been advancing rapidly in support of wind power generation.⁸⁹ We recommend that operators should have access to advanced meteorological forecasts to make use of any favorable conditions (e.g., wind blowing to unpopulated areas) when deciding to vent. The decision to vent should ultimately consider plant parameters (e.g., containment pressure and pressurization rate), the development of the situation on site (e.g., availability of power and radiological conditions), and the wind forecasts.

Data-informed adaptive evacuation zones

Protective actions and evacuation zones should be adaptive, informed by accident progressions, sensor datasets, and forecasts. The onsite accident progressions such as core status, containment venting plans, and expected source terms should inform the evacuation extent decisions. In fact, during the FDNPP accident, the evacuation zone extent was updated progressively following the onsite conditions from 2 km to 20 km, which was successful in mitigating the radiation exposure. However, these decisions were not part of the emergency plan, which resulted in significant confusions.

To facilitate such adaptive evacuation zones and actions, it is critical to continue integrating recent technological advances in sensors, observational platforms, as well as weather and plume simulations. There have been significant advances in radiation surveys including mobile platforms and rapidly deployable drones.⁹⁰ In addition, machine learning (ML)-based methods have been developed recently for integrating various types of measurements, such as real-time radiation monitoring points and ground/airborne-based surveys²⁴ as well as for optimizing sensor networks for long-term radiation monitoring.⁹¹ At the same time, *in situ* monitoring posts must have independent and reliable power sources in case of blackouts, and need to be efficiently distributed to rapidly capture the plume extent in case of accidents. These developments can help in updating the contamination maps in real time, hence, supporting an adaptive evacuation-zone extent that would reduce the public radiation exposure, as well as allow residents back into some areas—earlier—if the dose rate is not high after the accident

concludes. In particular, shrinking the evacuation zone is important to reduce unnecessary social and economic impacts as well as evacuation-induced health effects, given that prolonging the evacuation period tends to make the restoration process more difficult.

Reliable plume forecasts, or even wind/weather forecasts, should guide evacuation strategies and identify the priority areas for evacuation or the directions to evacuate, particularly when the plume is expected to move beyond the pre-planned area. ML is extensively applied in weather forecasting to accelerate simulations through surrogate modeling, to assimilate real-time monitoring data, and to improve the prediction accuracy and uncertainty quantification.⁹² Moreover, combining physical models (such as plume transport models) and real-time datasets is an active area of research (referred to as physics-informed ML) for improving both forecasting and mapping.⁹³ Recently, there are several ML applications to forecast the radioactive plume direction—up to several hours in advance—by analyzing wind patterns.⁹⁴

We would note that the FDNPP accident also provide critical lessons regarding the use of technologies in emergency situations, where the dose prediction system SPEEDI was not effectively used for guiding evacuations, and that many monitoring stations were not usable due to power failure. Therefore, the reliability of the systems should be evaluated, and integrating independent power supplies is vital. In addition, these technological advances and tools should be sufficiently tested and integrated in the broader context of the emergency response strategies so that many are aware of their effective use as well as their limitation and uncertainty. Adequate training for responsible decision-makers and personnel within the relevant technical support and government centers is imperative to ensure proficient utilization during emergencies.

Worth noting is the successful application of citizen science in radiation monitoring post-Fukushima, empowering the public to generate their own radiation data and monitor their environments.⁹⁵ Such a community radiation measurement program—coupled with new low-cost radiation sensors developed after the FDNPP accident—can be implemented as an STEM education curriculum in the surrounding regions of nuclear facilities before any accidents happen, which has a potential not only to improve the understanding of radiations but also to improve the emergency response.

Comprehensive risk-informed emergency planning

Off-site accident consequence assessments such as PRA level 3 (PRA-3) are critical for informing the EPZ extents and evacuation plans. Although PRAs have some uncertainties and limitations, the offsite consequence estimation in PRA-3 is critical for developing emergency response strategies. PRA-3 develops the potential accident scenarios, estimates the offsite radiological consequences, with uncertainty considered, and assesses what protective measures are effective, at which location and at what time. PRA-3 results can therefore guide the necessary emergency preparations, including the needed technological and human resources, as well as essential stockpiles (e.g., food, fuel, and medications). However, at the moment, PRA-3 is not a regulatory requirement in most countries;³ thus, we recommend mandating it as part of the licensing process to push its development and narrow down uncertainties, as well as to integrate the new technologies into emergency planning.

Recent risk studies have assessed that the major threat facing the current nuclear fleet are external natural hazards.⁹⁶ Therefore, PRA-3 assessments and emergency preparedness plans should take into account the full range of postulated events, covering scenarios that involve a combination of a nuclear accidents and a conventional emergency (such as an earthquake), which can further complicate the implementation of protective actions.⁹⁷

Furthermore, the FDNPP accident suggested that the health consequences were not just radiation-induced but could also result from evacuation, long-term relocation, and the associated psychological and social effects. Therefore, emergency response frameworks should consider all risk dimensions, which should be supported by data-informed risk-benefit analysis of the different protective actions. However, while nuclear accidents are rare and the corresponding response data are limited, other disaster classes, such as wildfires, hurricanes, and floods, occur in higher frequency and trigger large-scale evacuations and prolonged relocation.^{98,99} Specifically, evacuation-related risks have been well documented in these disasters,⁹⁹ with evacuation-dynamics models and strategies rapidly developing in their respective research communities,^{36,100} which can provide more reliable empirical data to support nuclear emergencies. As such, we find it critically important for the scientific community to exchange relevant data and strategies across different types of disasters. This can improve evacuation logistics and execution—including social behaviors and traffic—and enhance the resilience of nuclear energy societies.

STAR★METHODS

Detailed methods are provided in the online version of this paper and include the following:

- [KEY RESOURCES TABLE](#)
- [RESOURCE AVAILABILITY](#)
 - Lead contact
 - Material availability
 - Data and code availability
- [METHOD DETAILS](#)
 - PCV failure modes

ACKNOWLEDGMENTS

The authors would like to thank the Japan Atomic Energy Agency scientists Hiroaki Terada and Haruyasu Nagai for their thorough review and constructive feedback especially when it comes to the source term estimation and its relation to onsite events. We would also like to thank TEPCO's engineers and scientists Tatsuro Kobayashi, Masui Hideki, and Shinya Mizokami for their help in resolving several inquiries we had regarding the accident development, data, and post-accident retrofits. Furthermore, we thank Prof. Jacopo Buongiorno (MIT) for his constructive feedback on the manuscript, as well as Prof. Horst-Michael Prasser (Prof. em. ETH Zurich) for his valuable insights on containment designs and future needs. Finally, the authors would like to thank Russell Prentice (Pacific Gas and Electric Company) for the valuable discussions on the current emergency response practices in the nuclear industry.

AUTHOR CONTRIBUTIONS

A.A. and H.M.W. conceptualized the study. A.A. conducted the literature review, the analyses, and prepared the initial manuscript. A.A. and H.M.W. curated the analyses, interpreted the results, and revised the manuscript. G.S., R.G. (emeritus, Sandia National Laboratories), and K.S. helped in the results validation and manuscript editing.

DECLARATION OF INTERESTS

The authors declare no competing interests.

Received: October 13, 2023

Revised: January 21, 2024

Accepted: March 8, 2024

Published: March 11, 2024

REFERENCES

1. National Research Council (2012). *Disaster Resilience: A National Imperative*.
2. IAEA (2011). *Safety Standards-Safety of Nuclear Power Plants: Commissioning and Operation*. SSR-2/2.
3. Sornette, D., Kröger, W., and Wheatley, S. (2018). *New Ways and Needs for Exploiting Nuclear Energy* (Springer).
4. Ayoub, A., Stankovski, A., Kröger, W., and Sornette, D. (2021). The ETH Zurich curated nuclear events database: Layout, event classification, and analysis of contributing factors. *Reliab. Eng. Syst. Saf.* 213, 107781.
5. Ayoub, A., Stankovski, A., Kröger, W., and Sornette, D. (2021). Precursors and startling lessons: Statistical analysis of 1250 events with safety significance from the civil nuclear sector. *Reliab. Eng. Syst. Saf.* 214, 107820.
6. Perrow, C. (2011). *Normal accidents*. In *Normal Accidents* (Princeton university press).
7. Armstrong, R.C., Wolfram, C., de Jong, K.P., Gross, R., Lewis, N.S., Boardman, B., Ragauskas, A.J., Ehrhardt-Martinez, K., Crabtree, G., and Ramana, M.V. (2016). The frontiers of energy. *Nat. Energy* 1, 15020. <https://doi.org/10.1038/nenergy.2015.20>.
8. Tanigawa, K., Hosoi, Y., Hirohashi, N., Iwasaki, Y., and Kamiya, K. (2012). Loss of life after evacuation: lessons learned from the Fukushima accident. *Lancet* 379, 889–891.
9. Song, J.H., and Kim, T.W. (2014). Severe accident issues raised by the Fukushima accident and improvements suggested. *Nucl. Eng. Technol.* 46, 207–216. <https://doi.org/10.5516/NET.03.2013.079>.
10. National Research Council (2014). *Lessons Learned from the Fukushima Nuclear Accident for Improving Safety of U.S. Nuclear Plants* (The National Academies Press). <https://doi.org/10.17226/18294>.
11. Yang, J.E. (2014). Fukushima Dai-ichi accident: Lessons learned and future actions from the risk perspectives. *Nucl. Eng. Technol.* 46, 27–38. <https://doi.org/10.5516/NET.03.2014.702>.
12. Acton, J.M., and Hibbs, M. (2012). Why Fukushima Was Preventable (JSTOR).
13. Synolakis, C., and Kanoğlu, U. (2015). The Fukushima accident was preventable. *Philos. Trans. A Math. Phys. Eng. Sci.* 373, 20140379.
14. Nöggerath, J., Geller, R.J., and Gusiakov, V.K. (2011). Fukushima: The myth of safety, the reality of geoscience. *Bull. At. Sci.* 67, 37–46.
15. Callen, J., and Homma, T. (2017). Lessons learned in protection of the public for the accident at the Fukushima Daiichi nuclear power plant. *Health Phys.* 112, 550–559.
16. Ohba, T., Liutsko, L., Schneider, T., Francesc Barquiner, J., Crouail, P., Fattibene, P., Kesminiene, A., Laurier, D., Sarukhan, A., Skuterud, L., et al. (2021). The SHAMISEN Project: Challenging historical recommendations for preparedness, response and surveillance of health and well-being in case of nuclear accidents: Lessons learnt from Chernobyl and Fukushima. *Environ. Int.* 146, 106200.
17. Nakajima, T., Ohara, T., Uematsu, M., and Onda, Y. (2019). Environmental Contamination from the Fukushima Nuclear Disaster: Dispersion, Monitoring, Mitigation and Lessons Learned (Cambridge University Press).
18. Terada, H., Nagai, H., Tsuduki, K., Furuno, A., Kadowaki, M., and Kakefuda, T. (2020). Refinement of source term and atmospheric dispersion simulations of radionuclides during the Fukushima Daiichi Nuclear Power Station accident. *J. Environ. Radioact.* 213, 106104.
19. Yumimoto, K., Morino, Y., Ohara, T., Oura, Y., Ebihara, M., Tsuruta, H., and Nakajima, T. (2016). Inverse modeling of the 137Cs source term of the Fukushima Dai-ichi Nuclear Power Plant accident constrained by a deposition map monitored by aircraft. *J. Environ. Radioact.* 164, 1–12.
20. Ulmoen, M., Berge, E., Klein, H., Salbu, B., and Lind, O.C. (2022). Comparing model skills for deterministic versus ensemble dispersion modelling: The Fukushima Daiichi NPP accident as a case study. *Sci. Total Environ.* 806, 150128.
21. Mathieu, A., Korsakissok, I., Quélo, D., Groëll, J., Tombette, M., Didier, D., Quentric, E., Saunier, O., Benoit, J.P., and Isnard, O. (2012). Atmospheric dispersion and deposition of radionuclides from the Fukushima Daiichi nuclear power plant accident. *Elements* 8, 195–200.
22. Saito, K., Mikami, S., Andoh, M., Matsuda, N., Kinase, S., Tsuda, S., Yoshida, T., Sato, T., Seki, A., Yamamoto, H., et al. (2019). Summary of temporal changes in air dose rates and radionuclide deposition densities in the 80 km zone over five years after the Fukushima Nuclear Power Plant accident. *J. Environ. Radioact.* 210, 105878. <https://doi.org/10.1016/j.jenvrad.2018.12.020>.
23. Wainwright, H.M., Seki, A., Mikami, S., and Saito, K. (2019). Characterizing regional-scale temporal evolution of air dose rates after the Fukushima Daiichi Nuclear Power Plant accident. *J. Environ. Radioact.* 210, 105808. <https://doi.org/10.1016/j.jenvrad.2018.09.006>.
24. Wainwright, H.M., Seki, A., Chen, J., and Saito, K. (2017). A multiscale Bayesian data integration approach for mapping air dose rates around the Fukushima Daiichi Nuclear Power Plant. *J. Environ. Radioact.* 167, 62–69.
25. Kamiya, K., Ohto, H., and Yasumura, S. (2021). Report of the Fukushima Health Management Survey 2011–2020.
26. Tsubokura, M., Kato, S., Nomura, S., Morita, T., Sugimoto, A., Gilmore, S., Kami, M., Oikawa, T., and Kanazawa, Y. (2015). Absence of internal radiation contamination

- by radioactive cesium among children affected by the Fukushima Daiichi nuclear power plant disaster. *Health Phys.* 108, 39–43.
27. Suzuki, Y., Yabe, H., Yasumura, S., Ohira, T., Niwa, S.-I., Ohtsuru, A., Mashiko, H., Maeda, M., and Abe, M.; Mental Health Group of the Fukushima health management survey (2015). Psychological distress and the perception of radiation risks: the Fukushima health management survey. *Bull. World Health Organ.* 93, 598–605.
 28. Hasegawa, A., Ohira, T., Maeda, M., Yasumura, S., and Tanigawa, K. (2016). Emergency responses and health consequences after the Fukushima accident; evacuation and relocation. *Clin. Oncol.* 28, 237–244.
 29. Yabe, H., Suzuki, Y., Mashiko, H., Nakayama, Y., Hisata, M., Niwa, S.I., Yasumura, S., Yamashita, S., Kamiya, K., and Abe, M.; Mental Health Group of the Fukushima Health Management Survey (2014). Psychological distress after the Great East Japan Earthquake and Fukushima Daiichi Nuclear Power Plant accident: results of a mental health and lifestyle survey through the Fukushima Health Management Survey in FY2011 and FY2012. *Fukushima J. Med. Sci.* 60, 57–67.
 30. Sakai, A., Ohira, T., Hosoya, M., Ohtsuru, A., Satoh, H., Kawasaki, Y., Suzuki, H., Takahashi, A., Kobashi, G., Ozasa, K., et al. (2014). Life as an evacuee after the Fukushima Daiichi nuclear power plant accident is a cause of polycythemia: the Fukushima Health Management Survey. *BMC Publ. Health* 14, 1318.
 31. Nomura, S., Blangiardo, M., Tsubokura, M., Ozaki, A., Morita, T., and Hodgson, S. (2016). Postnuclear disaster evacuation and chronic health in adults in Fukushima, Japan: a long-term retrospective analysis. *BMJ Open* 6, e010080.
 32. IAEA (2015). The Fukushima Daiichi Accident.
 33. TEPCO (2012). Fukushima nuclear accident analysis report. https://www.tepco.co.jp/en/press/corp-com/release/betu12_e/images/120620e0104.pdf.
 34. Guarnieri, F. (2017). The Fukushima Daiichi nuclear accident: Entering into resilience faced with an extreme situation. In *Resilience: A new paradigm of nuclear safety*, J. Ahn, F. Guarnieri, and K. Furuta, eds. (Springer), pp. 1–17.
 35. Vetter, K. (2017). The Institute of Resilient Communities. In *Resilience: A New Paradigm of Nuclear Safety: From Accident Mitigation to Resilient Society Facing Extreme Situations*, J. Ahn, F. Guarnieri, and K. Furuta, eds. (Springer International Publishing), pp. 207–218. https://doi.org/10.1007/978-3-319-58768-4_16.
 36. Moritz, M.A., Battlori, E., Bradstock, R.A., Gill, A.M., Handmer, J., Hessburg, P.F., Leonard, J., McCaffrey, S., Odion, D.C., Schoennagel, T., and Syphard, A.D. (2014). Learning to coexist with wildfire. *Nature* 515, 58–66.
 37. Cutter, S.L., Ismail-Zadeh, A., Alcántara-Ayala, I., Altan, O., Baker, D.N., Briceño, S., Gupta, H., Holloway, A., Johnston, D., McBean, G.A., et al. (2015). Global risks: Pool knowledge to stem losses from disasters. *Nature* 522, 277–279.
 38. TEPCO (2012). Fukushima Nuclear Accidents Investigation Report. https://www.tepco.co.jp/en/press/corp-com/release/betu12_e/images/120620e0106.pdf.
 39. TEPCO (2022). Accident Overview at Fukushima Daiichi NPS. https://www.tepco.co.jp/en/nu/fukushima-np/review/review1_2-e.html.
 40. Nuclear Emergency Repose Headquarters (2011). Government of Japan, Report of the Japanese Government to the IAEA Ministerial Conference on Nuclear Safety—The Accident at TEPCO’s Fukushima Nuclear Power Stations. <https://www.iaea.org/report-japanese-government-iaea-ministerial-conference-nuclear-safety-accident-tepcos-fukushima-nuclear-power-stations>.
 41. TEPCO (2013). The Parameters Related to the Plants in Fukushima Daiichi Nuclear Power Station (Archives (2011)). <https://www.tepco.co.jp/en/nu/fukushima-np/f1/pla/2011/index-e.html>.
 42. Herranz, L.E., Pellegrini, M., Lind, T., Sonnenkalb, M., Godin-Jacqmin, L., López, C., Dolganov, K., Cousin, F., Tamaki, H., Kim, T.W., et al. (2020). Overview and outcomes of the OECD/NEA benchmark study of the accident at the Fukushima Daiichi NPS (BSAF) Phase 2—Results of severe accident analyses for Unit 1. *Nucl. Eng. Des.* 369, 110849.
 43. Lind, T., Pellegrini, M., Herranz, L.E., Sonnenkalb, M., Nishi, Y., Tamaki, H., Cousin, F., Fernandez Moguel, L., Andrews, N., and Sevón, T. (2021). Overview and outcomes of the OECD/NEA benchmark study of the accident at the Fukushima Daiichi NPS (BSAF), Phase 2—Results of severe accident analyses for unit 3. *Nucl. Eng. Des.* 376, 111138.
 44. Sonnenkalb, M., Pellegrini, M., Herranz, L.E., Lind, T., Morreale, A.C., Kanda, K., Tamaki, H., Kim, S.I., Cousin, F., Fernandez Moguel, L., et al. (2020). Overview and outcomes of the OECD/NEA benchmark study of the accident at the Fukushima Daiichi NPS (BSAF), phase 2—Results of severe accident analyses for unit 2. *Nucl. Eng. Des.* 369, 110840.
 45. Qi, B., Xiao, X., Liang, J., Po, L.C.C., Zhang, L., and Tong, J. (2022). An open time-series simulated dataset covering various accidents for nuclear power plants. *Sci. Data* 9, 766.
 46. GOVERNMENT OF JAPAN (2010). National Report to the 5th Review Meeting on the Convention on Nuclear Safety.
 47. Mizokami, S., and Rempe, J.L. (2021). The Events at Fukushima Daiichi. In *Encyclopedia of Nuclear Energy*, E. Greenspan, ed. (Elsevier), pp. 53–66. <https://doi.org/10.1016/B978-0-12-409548-9.12148-7>.
 48. TEPCO (2012). Leaks from Unit-3 PCV and steam release in a large amount. https://www.tepco.co.jp/en/press/corp-com/release/betu17_e/images/171225e0240.pdf.
 49. Ishikawa, M. (2015). A Study of the Fukushima Daiichi Nuclear Accident Process (Springer Japan).
 50. Hayano, R.S., and Adachi, R. (2013). Estimation of the total population moving into and out of the 20 km evacuation zone during the Fukushima NPP accident as calculated using “Auto-GPS” mobile phone data. *Proc. Jpn. Acad. Ser. B Phys. Biol. Sci.* 89, 196–199.
 51. TEPCO (2011). Radiation Dose Measured in the Fukushima Daiichi Nuclear Power Station (Archives). <https://www.tepco.co.jp/en/nu/fukushima-np/f1/data/2011/index-e.html>.
 52. TEPCO (2011). Analysis and evaluation of the operation record and accident record of Fukushima Daiichi NPS at the time of Tohoku-Chihou-Taiheiyou-Oki-Earthquake (Attachment). https://www.tepco.co.jp/en/press/corp-com/release/betu11_e/images/110524e16.pdf.
 53. Shimada, Y., Nomura, S., Ozaki, A., Higuchi, A., Hori, A., Sonoda, Y., Yamamoto, K., Yoshida, I., and Tsubokura, M. (2018). Balancing the risk of the evacuation and sheltering-in-place options: a survival study following Japan’s 2011 Fukushima nuclear incident. *BMJ Open* 8, e021482.
 54. Achim, P., Monfort, M., Le Petit, G., Gross, P., Douyset, G., Taffary, T., Blanchard, X., and Moulin, C. (2014). Analysis of radionuclide releases from the Fukushima Dai-ichi nuclear power plant accident part II. *Pure Appl. Geophys.* 171, 645–667.
 55. Final Report Investigation Committee on the Accident at Fukushima Nuclear Power Stations of Tokyo Electric Power Company (2012).
 56. Morino, Y., Ohara, T., Watanabe, M., Hayashi, S., and Nishizawa, M. (2013). Episode analysis of deposition of radiocesium from the Fukushima Daiichi Nuclear Power Plant accident. *Environ. Sci. Technol.* 47, 2314–2322.
 57. Fukushima Prefectural Government (2022). Fukushima Revitalization Station. <https://www.pref.fukushima.lg.jp/site/portal-english/en02-01.html>.
 58. Imanaka, T., Endo, S., Sugai, M., Ozawa, S., Shizuma, K., and Yamamoto, M. (2012). Early radiation survey of litate village, which was heavily contaminated by the Fukushima Daiichi accident, conducted on 28 and 29 March 2011. *Health Phys.* 102, 680–686.
 59. Satoh, H., Ohira, T., Hosoya, M., Sakai, A., Watanabe, T., Ohtsuru, A., Kawasaki, Y., Suzuki, H., Takahashi, A., Kobashi, G., et al. (2015). Evacuation after the Fukushima Daiichi nuclear power plant accident is a cause of diabetes: results from the Fukushima Health Management Survey. *J. Diabetes Res.* 2015, 627390.
 60. Igarashi, Y., Tagami, T., Hagiwara, J., Kanaya, T., Kido, N., Omura, M., Tosa, R., and Yokota, H. (2018). Long-term outcomes of patients evacuated from hospitals near the Fukushima Daiichi nuclear power plant after the Great East Japan Earthquake. *PLoS One* 13, e0195684.
 61. USNRC (2013). A comparison of U.S. and Japanese regulatory requirements in effect at the time of the Fukushima accident. <https://www.nrc.gov/docs/ML1332/ML13326A991.pdf>.
 62. UNSCEAR (2021). Sources, Effects and Risks of Ionizing Radiation UNSCEAR 2020/2021 Report, Levels and Effects of Radiation Exposure Due to the Accident at the Fukushima Daiichi Nuclear Power Station: Implications of Information Published since the UNSCEAR 2013 Report. UN. 9211423228. https://www.unscear.org/unscear/uploads/documents/unscear-reports/UNSCEAR_2020_21_Report_Vol. II.pdf.
 63. Zheng, J., Tagami, K., Bu, W., Uchida, S., Watanabe, Y., Kubota, Y., Fuma, S., and Ihara, S. (2014). ¹³⁵Cs/¹³⁷Cs isotopic ratio as a new tracer of radiocesium released from the Fukushima nuclear accident. *Environ. Sci. Technol.* 48, 5433–5438.

64. Martin, P.G., Louvel, M., Cipiccia, S., Jones, C.P., Batey, D.J., Hallam, K.R., Yang, I.A.X., Satou, Y., Rau, C., Mosselmans, J.F.W., et al. (2019). Provenance of uranium particulate contained within Fukushima Daiichi Nuclear Power Plant Unit 1 ejecta material. *Nat. Commun.* 10, 2801.
65. Kobayashi, S., Shinomiya, T., Ishikawa, T., Imaseki, H., Iwaoka, K., Kitamura, H., Kodaira, S., Kobayashi, K., Oikawa, M., Miyaushiro, N., et al. (2017). Low $^{134}\text{Cs}/^{137}\text{Cs}$ ratio anomaly in the north-northwest direction from the Fukushima Dai-ichi Nuclear Power Station. *J. Environ. Radioact.* 178–179, 84–94.
66. Bal, M., Jose, R.C., and Meikap, B.C. (2019). Control of accidental discharge of radioactive materials by filtered containment venting system: A review. *Nucl. Eng. Technol.* 51, 931–942. <https://doi.org/10.1016/j.net.2019.01.008>.
67. OECD/NEA/CSNI (2014). Status Report on Filtered Containment Venting. <https://www.oecd-nea.org/upload/docs/application/pdf/2020-01/csni-r2014-7.pdf>.
68. Valentin, J. (2007). International Commission on Radiological Protection. The 2007 recommendations of the international commission on radiological protection. *ICRP Publ.* 103, 2–4.
69. Oka, Y. (2022). Risks and benefits of evacuation in TEPCO's Fukushima Daiichi nuclear power station accident. *Prog. Nucl. Energy* 148, 104222.
70. Matsunaga, H., Orita, M., Liu, M., Kashiwazaki, Y., Taira, Y., and Takamura, N. (2022). Evaluation of residents' timing of return to or new settlement in Kawauchi Village, at 10 years after the Fukushima Daiichi Nuclear Power Plant Accident. *Int. J. Environ. Res. Public Health* 19, 543.
71. Smith, T. (2020). Criteria for development of evacuation time estimate studies. NUREG/CR-7002, Revision 1 (US Nuclear Regulatory Commission, Office of Nuclear Security and Incident).
72. NSC (2013). Emergency Preparedness for Nuclear Facilities (2007) (Government of Japan). www.nsr.go.jp/archive/nsr/anzen/sonota/houkoku/bousai220823.pdf.
73. Sugawara, S., and Juraku, K. (2018). Post-Fukushima controversy on SPEEDI system: contested imaginary of real-time simulation technology for emergency radiation protection. In *The Sociotechnical Constitution of Resilience* (Springer), pp. 197–224.
74. Tsujiguchi, T., Sakamoto, M., Koiwa, T., Suzuki, Y., Ogura, K., Ito, K., Yamanouchi, K., and Kashiwakura, I. (2020). A simple survey of the preparation situation for resident's evacuation in Japanese prefectures after the Fukushima Daiichi Nuclear Power Plant accident. *Front. Public Health* 8, 496716.
75. USNRC (2017). State-of-the-Art Reactor Consequence Analyses (SOARCA) Project: Sequoyah Integrated Deterministic and Uncertainty Analyses Draft Report. ADAMS ML17264A644.
76. Leelössy, Á., Lagzi, I., Kovács, A., and Mészáros, R. (2018). A review of numerical models to predict the atmospheric dispersion of radionuclides. *J. Environ. Radioact.* 182, 20–33.
77. Bradley, M.M. (2007). NARAC: an emergency response resource for predicting the atmospheric dispersion and assessing the consequences of airborne radionuclides. *J. Environ. Radioact.* 96, 116–121.
78. Neuscammen, S., and Yu, K. (2016). National atmospheric release advisory center dispersion modeling of the Full-Scale Radiological Dispersal Device (FSRDD) Field Trials. *Health Phys.* 110, 491–498.
79. Zhang, X.L., Su, G.F., Yuan, H.Y., Chen, J.G., and Huang, Q.Y. (2014). Modified ensemble Kalman filter for nuclear accident atmospheric dispersion: Prediction improved and source estimated. *J. Hazard Mater.* 280, 143–155.
80. Yamada, R., Tamakuma, Y., Iwaoka, K., Hosoda, M., Shiroma, Y., Akata, N., Mizuno, H., Yamada, K., Kuroki, T., and Tokonami, S. (2017). Measurement system for alpha and beta emitters with continuous air sampling under different exposure situations. *Appl. Radiat. Isot.* 126, 79–82.
81. Suzuki, A. (2014). Managing the Fukushima challenge. *Risk Anal.* 34, 1240–1256.
82. National Diet of Japan (2012). The Official Report of The Fukushima Nuclear Accident Independent Investigation Commission (The National Diet of Japan Tokyo).
83. Ojino, M., Yoshida, S., Nagata, T., Ishii, M., and Akashi, M. (2017). First successful pre-distribution of stable iodine tablets under Japan's new policy after the Fukushima Daiichi nuclear accident. *Disaster Med. Public Health Prep.* 11, 365–369.
84. Ohba, T., Tanigawa, K., and Liutsko, L. (2021). Evacuation after a nuclear accident: Critical reviews of past nuclear accidents and proposal for future planning. *Environ. Int.* 148, 106379.
85. IAEA (1994). Intervention Criteria in a Nuclear or Radiation Emergency. IAEA Safety Series No. 109 (INTERNATIONAL ATOMIC ENERGY AGENCY).
86. Peko, D., Basu, S., Kraft, S., Mizokami, S., and Rempe, J. (2018). Working together to enhance nuclear reactor safety. *Nucl. News* 36, e42.
87. Kröger, W., Sornette, D., and Ayoub, A. (2020). Towards safer and more sustainable ways for exploiting nuclear power. *World J. Nucl. Sci. Technol.* 10, 91–115.
88. NEI (2012). Diverse and Flexible Coping Strategies (FLEX) Implementation Guide (Nuclear Energy Institute).
89. Pryor, S.C., Barthelmie, R.J., Bukovsky, M.S., Leung, L.R., and Sakaguchi, K. (2020). Climate change impacts on wind power generation. *Nat. Rev. Earth Environ.* 1, 627–643.
90. Mukhopadhyay, S., Maurer, R., and Guss, P. (2020). Newer Aerial Platform for Emergency Response by the United States Department of Energy (SPIE), pp. 44–53.
91. Sun, D., Wainwright, H.M., Oroza, C.A., Seki, A., Mikami, S., Takemiya, H., and Saito, K. (2020). Optimizing long-term monitoring of radiation air-dose rates after the Fukushima Daiichi Nuclear Power Plant. *J. Environ. Radioact.* 220–221, 106281.
92. Sayeed, A., Choi, Y., Jung, J., Lops, Y., Eslami, E., and Salman, A.K. (2021). A deep convolutional neural network model for improving WRF simulations. *IEEE Trans. Neural Netw. Learn. Syst.* 34, 750–760.
93. Karniadakis, G.E., Kevrekidis, I.G., Lu, L., Perdikaris, P., Wang, S., and Yang, L. (2021). Physics-informed machine learning. *Nat. Rev. Phys.* 3, 422–440.
94. Yoshikane, T., and Yoshimura, K. (2018). Dispersion characteristics of radioactive materials estimated by wind patterns. *Sci. Rep.* 8, 9926.
95. Kenens, J., Van Oudheusden, M., Yoshizawa, G., and Van Hoyweghe, I. (2020). Science by, with and for citizens: rethinking 'citizen science' after the 2011 Fukushima disaster. *Palgrave Commun.* 6, 1–8.
96. Ayoub, A., and Sornette, D. (2023). The power of precursors: An empirical assessment of nuclear power risks. *Prog. Nucl. Energy* 164, 104878.
97. Atomic Energy Society of Japan (2014). The Fukushima Daiichi Nuclear Accident - Final Report of the AESJ Investigation Committee (Springer Tokyo). <https://doi.org/10.1007/978-4-431-55160-7>.
98. Wang, D., Guan, D., Zhu, S., Kinnon, M.M., Geng, G., Zhang, Q., Zheng, H., Lei, T., Shao, S., Gong, P., and Davis, S.J. (2021). Economic footprint of California wildfires in 2018. *Nat. Sustain.* 4, 252–260.
99. Dosa, D., Hyer, K., Thomas, K., Swaminathan, S., Feng, Z., Brown, L., and Mor, V. (2012). To evacuate or shelter in place: implications of universal hurricane evacuation policies on nursing home residents. *J. Am. Med. Dir. Assoc.* 13, 190.e1–190.e7.
100. McLennan, J., Ryan, B., Bearman, C., and Toh, K. (2019). Should we leave now? Behavioral factors in evacuation under wildfire threat. *Fire Technol.* 55, 487–516.
101. National Institute of Informatics (2011). Fukushima Daiichi Nuclear Power Plant Area Meteorological Data Archive: March 11–25. <http://agora.ex.nii.ac.jp/earthquake/201103-eastjapan/weather/data/wind-anl-20110311/surf/>.
102. Hessheimer, M.F., and Dameron, R.A. (2006). Containment Integrity Research at Sandia National Laboratories—An Overview. NUREG/CR-6906. <https://www.nrc.gov/docs/ML0624/ML062440075.pdf>.
103. Braun, M., Dirksen, G., and Losch, N. (2022). Optimized initiation criterion for a filtered containment venting in case of a severe accident in a nuclear power plant. *Nucl. Eng. Des.* 391, 111729. <https://doi.org/10.1016/j.nucengdes.2022.111729>.

STAR★METHODS

KEY RESOURCES TABLE

REAGENT or RESOURCE	SOURCE	IDENTIFIER
Deposited data		
Source term of total 131I, 131I chemical species (I2, CH3I, and particulate iodine), 134Cs, 137Cs, and 132Te	Supplemental data of Terada et al. ¹⁸	https://www.sciencedirect.com/science/article/pii/S0265931X19304473#appsec1
The physical parameters related to the plants in Fukushima Daiichi Nuclear Power Station	TEPCO	https://www.tepco.co.jp/en/nu/fukushima-np/f1/pla/2011/index-e.html
Radiation dose rates measured in the Fukushima Daiichi Nuclear Power Station 2011	TEPCO	https://www.tepco.co.jp/en/nu/fukushima-np/f1/data/2011/index-e.html
Weather data archive around Fukushima Daiichi Nuclear Power Plant: March 11-25, 2011 / Wind direction and speed (hourly atmospheric analysis) / Ground (10m) / In Japanese	Japanese National Institute of Informatics	http://agora.ex.nii.ac.jp/earthquake/201103-eastjapan/weather/data/wind-anl-20110311/surf/

RESOURCE AVAILABILITY

Lead contact

Further information and requests for resources should be directed to and will be fulfilled by the lead contact, Ali Ayoub (aliayoub@mit.edu).

Material availability

This study did not generate new unique reagents.

Data and code availability

- This paper analyzes existing, publicly available data. Information about access to the used datasets are listed in the [key resources table](#) and are given in the reference list.
- This paper does not report original code.
- Any additional information required to reanalyze the data reported in this paper is available from the [lead contact](#) upon request.

METHOD DETAILS

We reconstruct the timeline of the FDNPP accident, reactor dynamics, radioactive release, contamination, and evacuation zone situation, as well as the health effects, by synthesizing information from different sources. First, the timeline of the in-plant accident progression and government protective actions and emergency response are developed based on multiple official investigation reports.^{32,33,38–40} The pressure dynamics of the RPV and PCV for each unit were established using TEPCO's measurements datasets.⁴¹ It's important to highlight that since certain detectors and sensors were compromised during the accident, TEPCO curated these measurements by thoroughly evaluating the available information from different indicators, employing trending analysis, and considering uncertainties. Besides TEPCO's datasets, we rely on recent simulation studies^{42–45} to verify and timestamp significant physical events like core damage, breach of the RPV, core material relocation, and hydrogen explosion. These simulations draw conclusions by comparing different severe accident computer code outputs—analyzed by various organizations—to establish points of consensus and identify remaining uncertainties and data requirements.

The source term information is retrieved from a recent evaluation by Terada et al.,¹⁸ which is based on reverse-estimate calculations, coupling atmospheric transport and dispersion (ATD) simulations with monitoring data to find the optimal (matching) release rates. We also compare the major source term peaks with the actual dose rate measurements recorded by TEPCO's monitoring car at the FDNPP.⁵¹ Furthermore, we map the observed peaks to the concurrent onsite physical events that we could identify and anticipate to be behind these release patterns. We would note that the source term contains significant uncertainties (mainly from the ATD model assumptions and simulation results), and there can be some discrepancies with the assigned physical events, i.e., time lag or lead, release duration, and magnitude. Wind information during the accident is retrieved from the meteorological maps provided by the Japanese National Institute of Informatics.¹⁰¹ The study of the contaminated regions, relative contribution of the main plumes, and time evolution of the evacuation zones, are based on the Fukushima prefecture dose rate maps provided by the Prefectural Government (using real-time dosimeters).⁵⁷

Radiation exposure statistics are based on the Fukushima Health Management Survey,²⁵ Minamisoma city health check-ups,²⁶ and the radiation surveys in Iitate village.⁵⁸ We use the data provided by the National Diet of Japan⁸² and the Fukushima Health Management Survey,²⁵

as well as the analyses provided by Satoh et al.,⁵⁹ Tanigawa et al.,⁸ Hasegawa et al.,²⁸ Sakai et al.,³⁰ Suzuki et al.,²⁷ Yabe et al.,²⁹ and Igarashi et al.⁶⁰ to examine the nonradiation health effects and establish the collateral damage caused by evacuations, family separations, social distress, induced mental health problems, and patients' relocations.

PCV failure modes

The "Containment Integrity Program" at the Sandia National Laboratory¹⁰² defines two modes of PCV failure when the PCV exhibits beyond-design loads. The first is a functional failure, which is a progressive failure in which the PCV experiences beyond-design leakage rates associated with smooth and continuous pressure decrease. The second is a structural failure characterized by large global deformations and potential catastrophic rupture associated with a sudden loss of PCV pressure.

PCV failure depends on many parameters, such as the load distribution, duration, and temperature; accordingly, the fragility curve is usually modeled probabilistically as a function of "above-design excess pressure" and time.^{102,103} Therefore, it is not straightforward to predict exactly at which point of beyond-design the containment will fail, and whether it will fail functionally or structurally. This explains why the PCVs in Units 1 and 3 did not fail structurally as in Unit 2, even though they witnessed beyond-design pressures, and for quite a period of time in the case of Unit 1.